

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
(County)

Located in:

Corner Code #

- | | | |
|---------------------------------------|-------------------------|-------|
| 1. Public Land Survey | T 47 N. R 37 W. | F-7 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 4. Lot No. _____, Recorded Plat _____ | | |
| 5. Private Claims _____ | | |

REGISTER'S OFFICE

Houghton County, Mich.

Received for record the 21st day
of February A. D., 1996 at 3:45
o'clock P. M. and recorded in Vol. 329
of Land Corner Records Page 329
Richard L. Drahn Register

Register of Deeds Stamp & File Number

Quarter corner 16 & 21; T.47 N., R.37 W.

I, Richard L. Drahn in a field survey on May 25, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by E.C. Martin, Deputy Surveyor on August 25, 1851. Original bearing trees:

W. Pine	16"	S.62 E.	9 links	(5.94 feet)
W. Birch	12"	N.64 W.	25 links	(16.50 feet)

Corner research record on file with Houghton County. (4/18/95)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of the original corner or bearing trees recovered. Corner monumented on the centerline of an east-west road and on line with old fence lines north and south. Distance east and west to monumented section corners is consistent with the field notes of the original Government Survey.


SURVEY &
REMONUMENTATION

MAY 16 1997

COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position and one foot below the E-W road centerline, I set a 2½" x 18" iron pipe with a 3" brass cap, stamped to read: T.47 N., R.37 W; ¼; S-16, S-21; 1995; R.L.S. 21564. From this I set a 2½" x 30" aluminum Reference Monument with a 3½" stamped aluminum cap bearing South, 23.15 feet and the following bearing objects:
Midway Telephone Box # 3800 N.61 W. 51.01 feet
6' Sign rail N.52 E. 45.10 feet
3' x 3' x 5' Stone formation South 27.70 feet
6' Steel rail South 23.75 feet

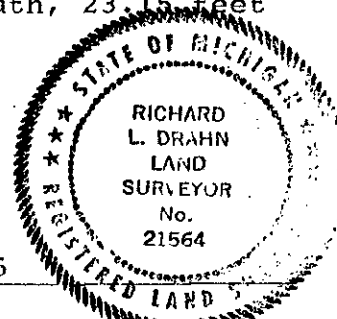

Signed by Richard L. Drahn

Date February 26, 1996

Surveyor's Michigan License No. 21564