

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

HOUGHTON
(County)

Located in:

Corner Code tt

- 1. Public Land Survey T 50N R 36W B-5
- T _____ R _____
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- In Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property In Sec. S _____ T _____ R _____

REGISTER'S OFFICE

Houghton County, Mich.

Received for record the 25th day
of April, A. D., 1995, at 11
o'clock A.M. and recorded in Vol. 3
of Richard L. Drahn, Page 215
..... Richard L. Drahn.....
Register

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

1/4 Corner, Sections 7, 18; T.50N., R.36W.

I, Richard L. Drahn in a field survey on November 4 1993
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law: established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by Algernon Merryweather, U.S. Deputy Surveyor, on October 5, 1852.
Original bearing trees:

Cedar	12"	S.75°E.	14 links	(9.24 feet)
Hemlock	7"	N.45°W.	28 links	(18.48 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Restored corner position at record bearing and distance from the remains of the original
bearing trees. The first is a 14" decayed and burned cedar stump with G.L.O. B.T. blaze
and ax marks visible. The second bearing tree is now a decayed hemlock stump. A 10"
cedar blazed on four sides with dates to 1922, bears S.45°W., 15.80 feet from the
original corner position.

SURVEY &
REMONUMENTATION

MAY 16 1997


COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a standard 2" diameter by 30" long split base aluminum
monument with a 3 1/4" aluminum cap stamped to read: T.50N., R.36W.; 1/4; S.7, S.18; 1993;
R.L.S. 21564: from which I established the following new blazed and scribed bearing
trees and/or reference objects:

12"	Hemlock	S.52°E.	8.44 feet
10"	Cedar	S.45°W.	15.80 feet
10"	Cedar	S.89°W.	14.35 feet

A 6' steel sign post bears: S.09°W, 2.34 feet

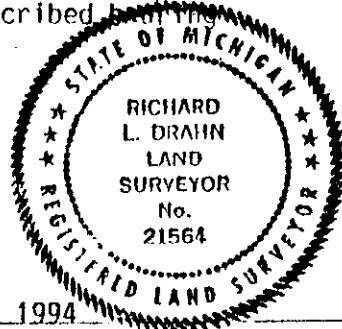

Signed by Richard L. Drahn

Date February 16, 1994

Surveyor's Michigan License No. 21564