

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located In:

Corner Code #

1. Public Land Survey	T <u>51N</u> R <u>36W</u>	<u>K6</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>13</u> T <u>51N</u> R <u>36W</u>	<u>10</u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

K6 Apr 04 2000
 10 Apr 03 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		10	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

A. Description of original monument and accessories and/or subsequent restoration:


(K6) Quarter corner common to Sections 13-14. Reestablished in 1970 and recorded in 1972 by A.O. Enger, RLS, by single proportionate measurement. 1" ID x 36" iron pipe with 4" aluminum cap. Hemlock 11 S09W 20.1', Sugar Maple 12 S88W 8.1'.
 (10-Sec. 13) South 1/16 corner between Sections 13-14. Corner established in 1970 and recorded in 1972 by A.O. Enger, RLS. 1" ID x 36" iron pipe with 4" aluminum cap. Sugar Maple 6 S32W 15.1', Red Maple 5 N55W 16.2'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K6) Recovered the 1970 monument, now with a broken cap, only the center portion remaining, stamped "1/4 14|13", set firmly, at record bearing and distance from the 1970 witnesses, both recovered in good condition with overgrown blazes. Left the monument in place and made two new witnesses as described below.
 (10-Sec. 13) Recovered the 1970 monument, as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum State of Michigan tablet, in good condition, and at record bearing and distance from the 1971 witnesses, both recovered in good condition. My measurements north and south to adjacent corners verifies the 1972 record. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K6) Found 1" pipe with broken aluminum cap. The 1970 witnesses:	(10) Found 1" pipe with 4" alum. cap. The 1970 wits:
15" Hemlock S13W 20.0' overgrown blazes	8" Sugar S37W 15.0' overgrown blazes
14" Sugar West 8.1' do	8" Maple N51W 16.1' do
Blazed and scribed the following:	Blazed and scribed the following:
7" Y. Birch N28E 38.2' "1/4S N8T"	8" Y. Birch N63E 35.4' "1/16S 8T"
13" Hemlock S58E 26.6' do	6" Y. Birch S01E 30.3' do
Bearings are magnetic. Distances are to notch in lower blaze. Squared a 4" Sugar N5W 3.0' to center of tree.	Placed squared Sugar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

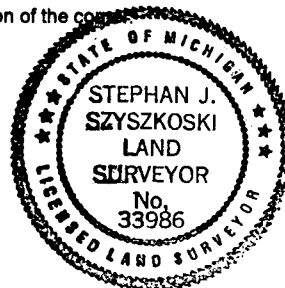

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/1/00

For the Michigan Department of Natural Resources - Forest Management Division