

SURVEY & REMONUMENTATION

JAN 22 1998

SECTION

Re-Now Liber 1, Page 109

1997 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SIGEL TOWNSHIP,

<u>HURON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>16</u> N R <u>14</u> E	<u>J-13</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

STATE OF MICHIGAN
HURON COUNTY
RECORDED

1 DEC 97 2:00 P.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Russell L. Brown, in a field survey on Oct. 20, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

1834 G.L.O. H. Parke D.S. Set quarter Section Post
B. Ash 11 inches in Diameter Corner Tree.
COUNTY SURVEYOR RECORDS: None
ACT 74 FORM: None
COUNTY ROAD CIMMISSION RECORDS: Iron Pin, Centerline grade and in line with fence to South
RECORDED SURVEYS: None


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original corner or accessories found.
Set 1/2" x 18" Dia. Steel Stake 78.68 feet East of 3/4" Re-rod in Monument Box, apparent Corner J-1, North 1/4 Corner Section 2, T15N-R14E,
78.68' being the average distance of the measured offsets between K-13, T16N-R14E and apparent K-1, T15N-R14E of 75.12 feet and I-13, T16N-R14E and apparent I-1, T15N-R14E of 82.24 feet.

This method of establishing corner fits North and South 1/4 line and West 1/8 line occupational field division lines existing in the field.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

South 1/4 Corner Section 35; T16N-R14E, J-13
Set 1/2" x 18" Steel Stake capped 24588 in monument box
WITNESSES:
N55°E 46.21' to 1/2" x 18" Steel Stake
S55°E 36.21' to 1/2" x 18" Steel Stake
S45°W 33.49' to 1/2" x 18" Steel Stake
N45°W 33.74' to 1/2" x 18" Steel Stake
West 78.68' to 3/4" Re-rod in Monument Box, apparent N. 1/4 Corner Section 2, T15N-R14E, J-1
East 2623.00' to Southeast Corner Section 35, T16N-R14E
West 2592.52' to Southwest Corner Section 35, T16N-R14E

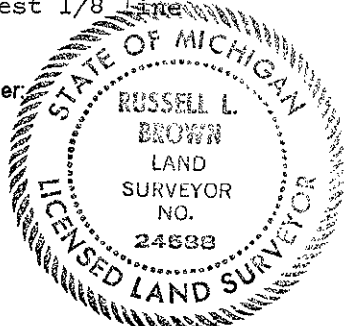

Signed by Russell L. Brown Date Nov. 3, 1997
Surveyor's Michigan License No. 24588

PEER GROUP APPROVED
AT MEETING HELD
Nov. 25, 1997 RLB