

Be Mon Ledger 1, Page 195

1998 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
HURON COUNTY
RECORDED

For Corners in

	<u>Huron</u> (County)	Located in:	Corner Code #
1. Public Land survey	Fairhaven	T <u>16</u> N R <u>9</u> E	J-13
		T _____ R _____	K-13
		T _____ R _____	
		T _____ R _____	
2. Property Controlling in Section	S _____	T _____ R _____	
	S _____	T _____ R _____	
3. Miscellaneous	S _____	T _____ R _____	

11 DEC 98 9:45 A.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

SURVEY &
REMONUMENTATION
JAN 28 1999
SECTION
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, James T. Meek, in a field survey on October 30, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Original Survey South Bdy. T16NR9E, 1835, Harvey Parke, D.S.

J-13 South ¼ Corner of Section 35
Post
Lynn 24", N80°E, 17 links
Elm 11", N74°W, 19 links

County surveyors record; iron pin
Recorded surveys: none
LCRC: none

K-13 Corner of Sections 35 and 36
Post
Beech 12", N88½°W, 49 links
Hemlock 14", N47½°E, 44 links

County surveyors record; ¾" iron
Recorded surveys: none
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-13 South ¼ Corner of Section 35

Found PK nail

At centerline of Kilmanagh Rd.

Accepted as the best available evidence of the original corner position.

K-13 Corner of Sections 35 and 36

Found ¾" iron

At intersection of Kilmanagh & Volz Rds.

Accepted as the best available evidence of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-13 South ¼ Corner of Section 35

Set ½" iron w/cap #39089 in mon box

From which:
Tag on wood post bears N6°E, 28.8'
½" iron bears S45°E, 20.0'
½" iron bears N45°W, 22.0'
½" iron bears S45°W, 20.0'


K-13 Corner of Sections 35 and 36

¾" iron in mon box

From which:
Tag in PP bears N38°W, 46.0'
Road sign post bears N33°W, 35.5'
East leg of direction sign bears S2°E, 25.8'
Road sign post bears S76°W, 90.5'

Signed by [Signature]
Surveyor's Michigan License No. 39089

Date December 8, 1998

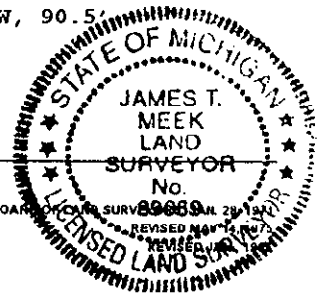

FORM APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS

APPROVED AT PEER BOARD MEETING, 11-24-98 R&B