

Re-Mon Liber 1, Page 240

1999 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
HURON COUNTY
RECORDED

28 OCT 99 9:11 A.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

For corners in

Huron (County)	Located in:	Corner Code #
1. Public Land Survey	Dwight T18N R13E	G-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Charles S. Getz, in a field survey on April 12, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5				4		3		2		1	
3													
4	7	8				9		10		11		12	
5													
6	18	17				16		15		14		13	
7													
8	19	20				21		22		23		24	
9													
10	30	29				28		27		26		25	
11													
12	31	32				33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

G-13 1834 G.L.O., H. Parke D.S. County Road Commission Records - 3/4" Iron Pin in Wood Post Set Post
 Fir 9", N75°E, 28 Links Recorded Surveys -
 Hemlock 11", N56°W, 40 Links Case, 4-24-73, Liber 1, Page 438, 3/4" iron pin in place
 Case, 7-9-81, Liber 4, Page 541, 3/4" iron pin in place
 L.C.R.C. - NONE Unrecorded Surveys - NONE
 County Surveyor Records - NONE


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-13
 SW Cor, Section 34, T18N-R13E
 Found 3/4" Iron Bar in Monument Box
 Accepted as the best available evidence of original corner position
 (Intersection of Kinde & Carpenter Roads)

RECORDED
 FEB 13 2000
 SECTION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13
 SW Cor, Section 34, T18N-R13E
 Found 3/4" Iron Bar in Monument Box
 West 115.70' to Monument Box
 N30°W 40.00' to Stop Sign
 N45°W 52.00' to Power Pole
 South 20.95' to East Leg of Road Sign
 S70°W 91.70' to East End of Culvert
 S65°W 85.90' to Nail in Telephone Pole
 West 2624.12' to S 1/4 Cor, Sec 33, T18N-R13E
 East 2629.80' to S 1/4 Cor, Sec 34, T18N-R13E

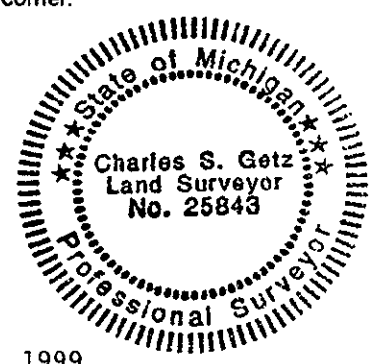

Signed by Charles S. Getz
 Surveyor's Michigan License No. 25843

Date August 14, 1999

PEER GROUP APPROVED AT MEETING
 HELD October 26, 1999 R&B