

LIBER 3 PAGE 240

HILLSDALE COUNTY REMONUMENTATION, LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED 007831 HILLSDALE CO. MICH.

98 AUG 5 AM 10:24

Judy VanZandt REG. OF DEEDS

For corners in

Hillsdale (County)

Located In: Corner Code #

- 1. Public Land Survey T 6S R4W C-4
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat

5. Private Claims

I, Frederick J. Cutcher, in a field survey on May 16, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G. L. O. by Wm. Brookfield, 1825: Beech 8" S, 78° E. 32 lks; Beech 5" S, 55 1/4° W. 34 lks.

LCRC 2864, A. John Hatt, 5/31/72: Found broken pointed stone surrounded by stones. Witnesses: 5' North of fence line West; 15" Walnut, N. 70° E. 26.78'; 1 1/2" Well Pipe N. 75° W. 30.60'; fence corner S. 85° E. 28.80'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On 5/16/98 found pinch top iron beside pointed stone surrounded by stones at road surface.

Two witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set 3/4" x 36" county remonumentation iron with cap in a monument box and is accepted as the best available evidence of the position of the original corner.

About 2' East of the centerline of Hog Creek Road Mag. Nail North side pwr. pole S. 79° W. 49.23' Top center of 1-1/2" Well Pipe N. 58° W. 30.08' Center of steel fence corner post N. 53° W. 40.35' Nail & Spotter South side 24" Walnut N. 94° E. 27.51' Nail & Spotter South side 18" Maple N. 65° E. 39.07'

Signed by Frederick J. Cutcher

Date AUG. 5, 1998

Surveyor's Michigan License No. 24592

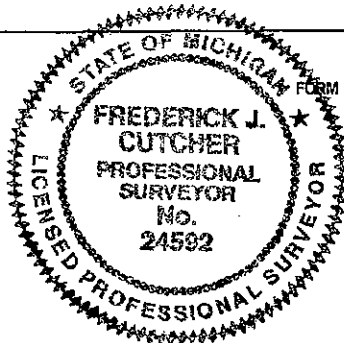

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 197 REVISIONS: REVISED MAY 14, 197 REVISED JAN., 198 REVISED OCT., 199

SURVEY & REMONUMENTATION

FEB 23 1999

SECTION