

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY <u>29</u> T. <u>2</u> N. <u>1</u> E.	<u>1</u> R. <u>1</u> E.	<u>D-11, E-11</u>
2. PROPERTY CONTROLLING IN SECTION _____, T. _____, N. _____, S. _____, R. _____, E. _____, W. _____		
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____, N. _____, S. _____, R. _____, E. _____, W. _____		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Ingham Co.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Donald L. Bissell, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on April, 1985, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

<p>D-11 Found: 1" x 1" Iron Pin Nail & Washer in triple 12" Cherry N02°E26.87 Nail & Washer in 12" Cherry N35°E 23.72 Nail & Washer in 8" Oak N50°W. 36.72' Set: 4" x 36" Conc. mon. with alum. cap.</p>	<p>E-11 Found: Anchor Post Nail & Washer 24"Oak N89°E 12.25' Nail & Washer 15" Hickory S.31.17' Nail & Washer 30" Oak W. 22.40' Set: 4" x 36" Conc. mon. with alum. cap.</p>
--	--

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p>D-11 Conc. mon. with alum. cap N60°W. 36.62' 16" B. Oak N08°E. 27.41' 15" Twin Cherry N46°E. 23.74' 12" Wild Cherry S70°E. 45.31' 10" S. Maple All trees have spikes and Blaze</p>	<p>E-11 Conc. mon. with alum. cap S85°W. 22.40' 30" Hickory N02°E. 42.58' 5" Maple N82°E. 12.95' 24" R. Oak S04°E. 31.17' 12" Hickory All trees have spike and blaze</p>
---	--

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. 18655

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Donald L. Bissell DATE _____
CHEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

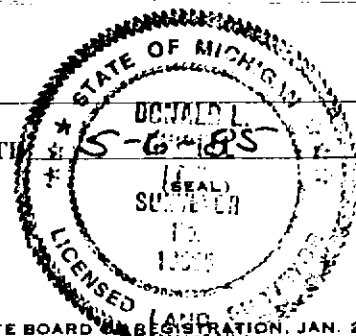

SURVEYOR'S MICHIGAN REGISTRATION NO. 18655