

**SURVEY &  
REMONUMENTATION**

DEC 09 1999

SECTION

**LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in ALAIEDON TOWNSHIP

INGHAM COUNTY Located In: Corner Code #

1. Public Land Survey T 3N R 1W G-3  
 T R  
 T R  
 T R

2. Property Controlling S T R  
 in Section S T R

3. Miscellaneous S T R  
 Property in Sec. S T R

Paula Johnson  
INGHAM COUNTY  
REGISTER OF DEEDS  
WOLVERINE ENGINEERS

RECORDED L-9 P-547  
CRNR 11.00 1999-056028



Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Maurice H. Mahieu, in a field survey on October 26, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- Original corner set by Joseph Wampler D.S. on December 17, 1826 at a distance of 80.00 chains from G-5. "Set post cor. Secs. 3,4,9 & 10 fw. Lynn 6 S 30 E 29. Sugar 14 N 72 1/2 W 27."
- County Surveyor's records Book 2, Page 177 shows a set of surveys by A.P. Drake, County Surveyor, on October 13, 14, and 15, 1879 in which he recorded the corner as being a post with the following witness: "Sugar 12 S 41 E 38 1/2." Corner measured 40.26 chains (2657.16') from G-2.
- Ingham County Road Commission records dated 1963 describe corner as a 1 1/4" iron with the following witnesses: 36" Maple SE 37.09'; 10" Locust S 34.11'; 3/4" iron NNW 37.09'; 12" Maple N 26.67'; 6" Maple NE 50.83'.

(Continued on Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found a boat spike in the centerline of asphalt Sandhill Road and on a fence line South. Found witnesses: Nail and Tag #39100 E. side 24" Poplar S 8° E 34.07', Nail and Tag #25832 W. side 12" Poplar S 37° E 28.90', Nail and Tag #25832 NW side 30" Maple N 57° E 51.39', P.K. Nail in SW side 20" White Pine N 44° W 129.35'. Dug a 2' x 2' pit. Found a 1 1/2" x 18" iron rod ±1.5' below asphalt surface. Position of 1 1/2" iron directly under that of the boatspike. Found large chunks of brick in the center of pit ±2.5' below asphalt surface. Continued digging to a final depth of ±4'. Accepted position of boatspike and 1 1/2" iron as best perpetuated location for the corner. Set a 3/4" x 24" iron form pin and 2 1/2" diameter aluminum P.A. 345 cap #28414 in that position and set a monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

3/4" x 24" iron form pin and 2 1/2" diameter aluminum P.A. 345 cap #28414, witnessed by: <sup>in monument box</sup>  
 Nail and Tag #39100 E. side 24" Poplar, S 8° E 34.07'  
 Nail and Tag #25832 W. side 12" Poplar, S 37° E 28.90'  
 Nail and Tag #25832 NW side 30" Maple, N 57° E 51.39'  
 P.K. Nail in SW side 20" White Pine N 44° W 129.35'

Signed by Maurice H. Mahieu

Date 10-29-99

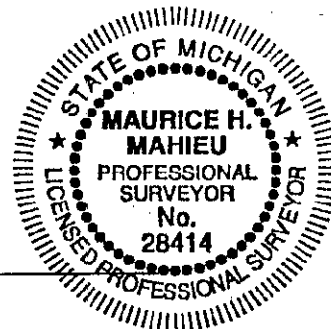

Surveyor's Michigan License No. 28414



(A. CONTINUED)

G-3 T3N, R1W

4. A L.C.R.C. recorded in Liber 2, Page 71 by Charles C. Wilson R.L.S. #13604 on August 31, 1972 describes corner as a found boatspike in pavement. Surveyor Wilson found the boatspike using the remaining witnesses in A.3.
5. An Act 132 survey recorded in Liber 2, Page 516 by Ronnie M. Lester R.L.S. #18998 on October 16, 1975 describes corner as a found 1/2" bar measuring 2654.12' from H-3. Witnesses: Nail and Tag W. side 12" Apple N 35.21'; Nail and Tag W. side 16" Elm SE 36.50'; Nail and Tag N. side 10" Walnut SE 82.91'.
6. An Act 132 survey recorded in Liber 8, Page 176 by Terry L. Wiegman P.S. #39100 on April 7, 1998 describes corner as a found boatspike in centerline Sandhill Road and ± tree line to South. Corner measured 2657.10' from G-2. Witnesses: Nail and Tag #25832 W. side 12" Locust SE 29.00'; Nail and Tag #25832 NW side 24" Maple NE 51.44'; Nail and Tag #25832 E. side 6" Wood Post SW 39.74'; Nail and Tag #39100 NE side 18" Locust S 34.10'.
7. An Act 132 survey recorded in Liber 8, Page 364 by Larry A. Bryan P.S. #25832 on November 19, 1998 describes corner as a found boatspike in centerline of Sandhill Road. Corner measured 2659.83' from F-3 and 2657.43' from G-2. Witnesses: P.K. Nail SW side 16" Pine N 55° W 129.41'; Nail and Tag #25832 W. side 10" Walnut S 25° E 29.02'; Nail and Tag NW side 18" Maple N 60° E 51.45'; Nail and Tag E. side Anchor Post S 45° W 49.72'.

SURVEY &  
REMONUMENTATION

DEC 09 1999

SECTION