

**IOSCO COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN  
IOSCO COUNTY  
FILED

For corners in

<u>  Iosco  </u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 21NR 6E T 21NR 7E T ___ R ___ T ___ R ___	M-11 <u>A-11</u>
2. Property Controlling in Section	S ___ T ___ R ___ S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___ S ___ T ___ R ___	_____

20 DEC 99 10:13 A.M.

RONITA N. COYLE  
REGISTER OF DEEDS

99 - 54

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, JAMES H. GRANGER, in a field survey on November, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

1837 GLO	Set Wood Post	
Lewis Clawson	8" B. Ash	S34 W 5lks
	8" B. Ash	N40 W 24lks

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**


Found 1914 survey documents on Mc Mullen Drain showing corner to be on W. side of Drain. Straight line between SE Sec. 36 and NE Sec. 24 falls on E. side of Drain. Extended Mc Mullen Drain line S. to establish potential position. No original evidence found at either location. Concluded to extend line on W. side of Drain S. to establish corner position because if straight line from M-11 to M-13 were used, the Township line would cross the Drain at the S1/8 cor and 1914 survey shows Township line on W. side of Drain at S1/8 cor.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

5/8" x 30" rebar w/ Remon Cap		
12" B. Ash	S58 W	18.59' nail & lag 16041
15" soft Maple	N36 W	15.68' nail & cap 16041
4" Dbl Ash	N25 E	28.82' nail & cap 16041
1" galv. Pipe	S87 E	2.56' nail & cap 16041

ACCEPTED BY THE IOSCO COUNTY  
SURVEY PEER GROUP AS THE  
OFFICIAL CORNER UNDER P.A.  
343 OF 1990 AT A MEETING  
HELD ON 10-13-99

*James H. Granger*

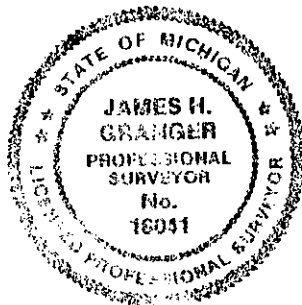

Signed by James H. Granger  
Surveyor's Michigan License No. 16041

Date December 16, 1999

REA

APR 27 2000

SECTION