

**IOSCO COUNTY REMONUMENTATION CORNER  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

IOSCO

(County)

Located In:

Corner Code #

1. Public Land Survey

T22N R SE

I-4

T \_\_\_ R \_\_\_

T \_\_\_ R \_\_\_

T \_\_\_ R \_\_\_

2. Property Controlling in Section

S \_\_\_ T \_\_\_ R \_\_\_

S \_\_\_ T \_\_\_ R \_\_\_

3. Miscellaneous Property in Sec.

S \_\_\_ T \_\_\_ R \_\_\_

S \_\_\_ T \_\_\_ R \_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, William J. Rigg, in a field survey on August, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	19		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

000 2000

STATE OF MICHIGAN  
IOSCO COUNTY  
FILED  
3-2000  
3 JAN 0 3:42 P.M.

Register of Deeds Stamp & File Number

A. Description of original monument and accessories and/or subsequent restoration:

- 1844 +/- G.L.O Survey  
10" Beech N82W .03 lks  
10" Beech S60E .63 lks
- 1950 +/- MDOT Highway Maps
- 1989 Survey by Northeast Land Surveys found pipe with cap

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Bolt spike as held in previous surveys and Highway Maps.


ACCEPTED BY THE IOSCO COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER P.A. 345 OF 1990 AT A MEETING HELD ON 10-13-99

*James H. Granger*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted position of Bolt spike and replaced with a 5/8" rebar with Remon Cap.

- S45W 40.30' Top center of Concrete Culvert
- S70E 192.50' 10" Elm
- N70E 117.65' Power Pole
- N45W 53.23' Power Pole

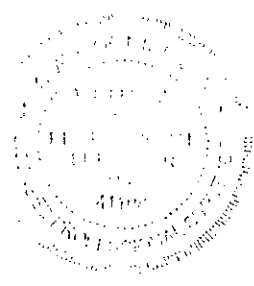

Signed by William J. Rigg  
Surveyor's Michigan License No. 41108

Date Dec 27, 99

SECTION