

FEB 15 2001

SECTION

IOSCO COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

IOSCO (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>22N</u> R <u>5E</u>	<u>K-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

017 2001

STATE OF MICHIGAN  
IOSCO COUNTY  
FILED

13 FEB 2001 9:21:24 AM

BONITA M. COYLE  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, William J. Rigg, P.S., in a field survey on October 12, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:  
1844 +/-, GLO Survey, set post, 12" Cedar, N54E 22 lks, 15" Hemlock, N12W 31 lks  
1990 Phil Case, Found K-1 for Township South, Liber 90, Page 25

ACCEPTED BY THE IOSCO COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER P.A. 345 OF 1990 AT A MEETING HELD ON 10-11-2000

*James H. Ganger*


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found capped iron by Phil Case (K-1 T21N, R5E) as shown on LCRC  
E-W fence and iron falls 80' +/- North (GLO Call) of top of bank to old Creek Bed  
GLO call of 165' to East agrees more or less, but is not definable within the 17.82' difference between standard & closing corners  
GLO call of 165' to West does not fit top of bank to river. (M = 45' +/- to Old Bed)

Accepted N-S position as it did fit GLO call, Established corner 17.82 feet East of K-1 for T21N, R5E, on line with L-13, T22N, R5E as called for by GLO notes. possible GLO stump N54E 14'+/- of this position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" Rebar and Remon Cap  
N15W - 6" Cedar - 8.91'  
N87W - 17.82' Capped Iron #30079  
S58W 15.67' 20" Cedar  
S20W 9.58' 10" poplar  
N88E 4.06' 4" Cedar

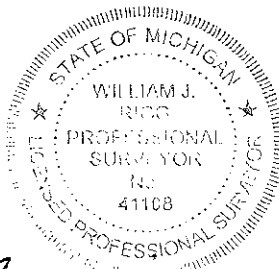

Signed by *William J. Rigg*  
Surveyor's Michigan License No. #41108

Date December 22, 2000