

SURVEY & REMONUMENTATION

DEC 13 1993

IOSCO COUNTY REMONUMENTATION CORNER LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

REGISTER OF DEEDS
 IOSCO COUNTY, MICH.

Richard L. Miller

Nov 24 4 31 PM '93

93-11

FILED

COMMISSION

For corners in

IOSCO (County)	Located In:	Corner Code -#
1. Public Land Survey	T <u>22N</u> R <u>6E</u>	<u>E-7</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5		4	3	2	1						
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


I, RICHARD L. MILLER in a field survey on OCTOBER 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- 1843 ORIGINAL SUBDIVISION MULLETT & BURT
 SET WOOD POST
 24" W. PINE N.69 E. 13 LKS
 12" W. PINE S.01 W. 12 LKS
 - 1931 DEPENDANT RESURVEY GUY VEAL, APPROVED 1933
 SET 3 1/2" BRASS TABLET IN 6" DIAMETER CONCRETE CYLINDER, 24" LONG
 #1-8" NORWAY PINE N.14 3/4 E. 174 LKS
 #2-10" POPLAR S.27 1/2 E. 84 LKS
 #3-10" W. PINE S.80 3/4 W. 119 LKS
 #4-8" W. PINE N.57 1/2 W. 100 LKS

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- 1931 MONUMENT REMOVED BY EXCAVATION. RE-ESTABLISHED BY 1931 WITNESS FOUND
 - #3 (NOW) 24" STUMP S.80 3/4 W. 119 LKS
 - #1 (NOW) 24" STUMP N.14 3/4 E. 174 LKS
 - #4 (NOW) 18" W. PINE N.57 1/2 W. 100 LKS

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- SET MONUMENT CONSISTING OF 3 ALUMINUM DISC ATTACHED TO 5/8" RE-ROD 30" LONG PLACED 6" ABOVE SURFACE. MARKED T.22N.-R.6E. 16-17-20-21
 - SET WITNESS TAG IN S.W. SIDE 18" W. PINE N.57 W. 66.00' (1931)
 - SET WITNESS TAG IN S.E. SIDE 9"-11" DBL MAPLE S.75 W. 34.69'
 - SET WITNESS TAG IN S.W. SIDE 15"-9"-12" TRIPLE OAK S.45 E. 38.18'
 - SET WITNESS TAG IN S.E. SIDE 7" W. PINE N.50 E. 40.48'

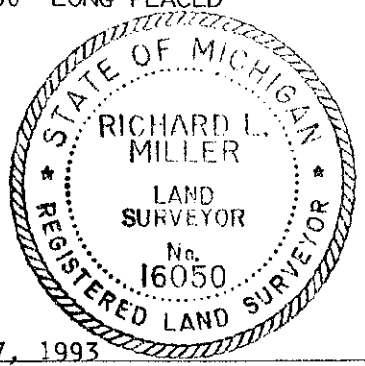

Signed by *Richard L. Miller* Date NOVEMBER 17, 1993
 Surveyor's Michigan License No. 16050