

**SURVEY &
REMONUMENTATION**

APR 27 1995

COMMISSION

STATE OF MICHIGAN
IOSCO COUNTY
FILED
IOSCO COUNTY REMONUMENTATION CORNER
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

5 DEC 94 2:02 P.M.

BONITA H. COYLE
REGISTER OF DEEDS

94-44

Register of Deeds Stamp & File Number

For corners in

IOSCO <small>(County)</small>	Located In:	Corner Code #
	T <u>22N</u> R <u>9E</u>	<u>C-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
1. Public Land Survey	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, John F. Oliver in a field survey on October 3, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1843 Original Survey, J.F.Munro set wood post
10" S. pine N41E 15 links
10" S pine S49°W 23 links

1992 Survey by James Granger, indicates found R.R. spike in monument box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1994 Accept position as established by survey.

found R.R. spike in monument Box.

Set 5/8"X 30" Re-bar with aluminum cap in monument box


ACCEPTED BY THE IOSCO COUNTY
SURVEY PEER GROUP AS THE
OFFICIAL CORNER UNDER P.A.
345 OF 1990 AT A MEETING
HELD ON 11-10-94

James H. Granger

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8"X 30" re-bar with aluminum cap

power pole N67°W 99.12
12" Red pine N70°E 69.83
10" Oak S30°E 92.67
10" Oak S72°W 72.93

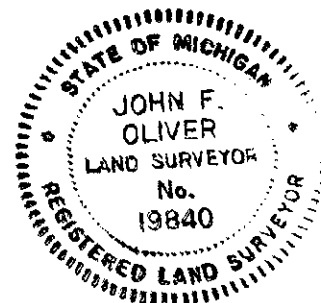

Signed by *[Signature]*
Surveyor's Michigan License No. 19840

Date 11-11-94