

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

IRON COUNTY

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 41 N. <del>XX</del> R. 31 <del>XX</del> W.	L9
2. PROPERTY CONTROLLING IN SECTION 24	T. 41 N. <del>XX</del> R. 31 <del>XX</del> W.	7, 14, 16
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____ R. _____ E. _____ S. _____ W. _____	
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- L9: Found what I believe to be an original accessory white quartz rock two feet across N62E 13.2 ft.
- Corner 7: Not set on original survey nor subsequently apparently.
- Corner 14: Not set on original survey nor subsequently apparently.
- Corner 16: Not set on original survey nor subsequently apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- Corner L9: Restored 6-1-83 from white quartz rock.
- Corner 7: Established 6-7-83 on line between section corner north and 1/4 corner south.
- Corner 14: Established 6-6-83 on line between 1/4 corner north and section corner south.
- Corner 16: Established 6-6-83 on line between 1/4 corner west and section corner east.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- |  |  |
|--|--|
| <p><b>Corner L9:</b> Set 1" I.D. by 32" I.P. with 4" alum. cap.<br/>                     5" Oak N17W 9.2 ft. 1/4S, NBT<br/>                     9" Oak S77W 33.6 ft. 1/4S, NBT<br/>                     6" Oak S18E 26.6 ft. 1/4S, NBT<br/>                     White quartz rock N62E, 13.2 ft.<br/> <b>Corner 7:</b> Set 1" I.D. by 32" I.P. w/4" alum. cap<br/>                     12" R. pine S28E 2.7 ft. 1/16S, BT<br/>                     12" R. pine S88W 24.0 ft. 1/16S, BT</p> | <p><b>Corner 14:</b> Set 1" I.D. by 32" IP w/4" alum. cap<br/>                     7" Oak S61W 40.0 ft. 1/16S, BT<br/>                     5" Cherry N10E 23.0 ft. 1/16S, BT<br/>                     4" Cherry S15E 34.3 ft. 1/16S, BT<br/> <b>Corner 16:</b> Set 1" I.D. by 32" I.P. w/4" alum. cap<br/>                     12" Oak N50W 31.9 ft. 1/16S, BT<br/>                     4" Sugar S89E 19.8 ft. 1/16S, BT<br/>                     10" Y. birch S14W 22.8 ft. 1/16S, BT</p> |
|--|--|


SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Keith L. Sackett DATE 6-29-83  
MICHIGAN REGISTERED LAND SURVEYOR

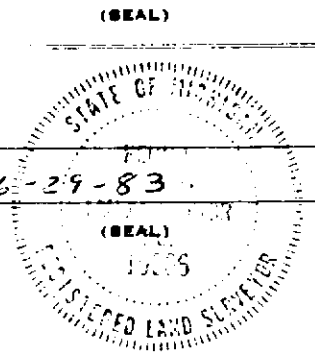

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006