

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	(IRON COUNTY) LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>41</u> N. <u>X</u> , R. <u>32</u> E. <u>X</u> W. _____	I-4
2. PROPERTY CONTROLLING IN SECTION <u>11</u>	, T. <u>41</u> N. <u>X</u> , R. <u>32</u> E. <u>X</u> W. _____	3 & 10
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____ S. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 28, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner I4 (1/4 corner between Sections 10 & 11, T41N, R32W):
 Hemlock 16 for corner (Not found. No subsequent monuments found.)
 No bearing trees (Not found. No subsequent accessories found.)

Corner 3 (North 1/16 corner between Sections 10 & 11, T41N, R32W) and
Corner 10 (South 1/16 corner between Sections 10 & 11, T41N, R32W):
 Neither of these corners set in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner I4: Restored on line between Sec. Corners 39.929 ch. to N and to S.

Corner 3: Established on line between Sec. Cor. 19.9645 ch. N and 1/4 cor. 19.9645 ch. S.

Corner 10: Established on line between 1/4 cor. 19.9645 ch. N and Sec. Cor. 19.9645 ch. S.
 Found a 12" aspen, blazed on 4 sides, on a N & S fence line S68°E 72.4 ft. for an approximate corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all three corners: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap

Witnesses for Corner I4: Red Oak 13 N54°E (mag.) 32.3 ft. "1/4S, NBT"
 Red Oak 9 S53°E (mag.) 52.0 ft. "1/4S, NBT"
 Distances horizontal, Declination 0°20' East.

Witnesses for Corner 3: Red Maple 6 N76°E (mag.) 20.7 ft. "1/16S, BT"
 Red Maple 6 S63°E (mag.) 22.5 ft. "1/16S, BT"
 Distances horizontal. Declination 0°50' East.

Witnesses for Corner 10: Aspen 10 N73°E (mag.) 24.3 ft. "1/16S, BT"
 Aspen 12 S28°E (mag.) 40.6 ft. "1/16S, BT"
 Declination is 0°15' West.

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger
 CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

DATE January 10, 1979

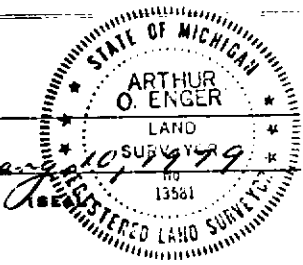

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581