

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> N. 36 R. <u>31</u> W. ^{XX}	K8
2. PROPERTY CONTROLLING IN SECTION <u>24</u>	, T. <u>42</u> N. 36 R. <u>31</u> W. ^{XX}	3 & 10
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corner K8: Cedar post (Not found. No subsequent monuments found.)
 Spruce 10 N33E 26 (" " " " accessories ")
 Fir 8 S49W 27 (" " " " " ")
Corners 3 & 10: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
Corner K8: Re-established 5/24/74 on line between Sec. Cor. 40.110 ch. to N and to S.
Corner 3: Established 5/30/74 on line between Sec. Cor. 20.055 ch. N and 1/4 cor. 20.055 ch. S.
Corner 10: Established 5/24/74 on line between Sec. Cor. 20.055 ch. S and 1/4 cor. 20.055 ch. N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Corner K8: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Cedar 9 N69°E (mag.) 11.9 ft. "1/4S, NBT"
 Cedar 12 S15°E (mag.) 21.1 ft. "1/4S, NBT"
Corner 3: 1" I.D. x 42" iron pipe with 3 1/2" aluminum cap.
 Red Maple 7 N46°W (mag.) 36.0 ft. "1/16S, BT"
 B. Ash 4 N2 1/2°E (mag.) 15.3 ft. "1/16S, BT"
Corner 10: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Hemlock 16 S54°E (mag.) 27.8 ft. "1/16S, BT"
 W. Pine Stump 19 N59°E (mag.) 5.5 ft. "1/16S, BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger CHIEF OF SURVEY PARTY DATE August 29, 1974
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

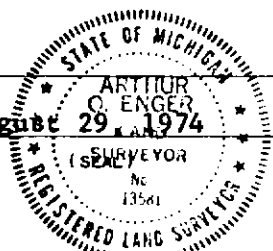

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581