

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|--|---|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. <u>42</u> N. <u>31</u> 31 R. <u>31</u> 31 W. | H 5 |
| 2. PROPERTY CONTROLLING IN SECTION <u>10</u> | T. <u>42</u> N. <u>31</u> 31 R. <u>31</u> 31 W. | 14 & 15 |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ N. _____ R. _____ E. _____ W. | |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19 , established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19 , found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner H5: W. Birch post (Not found. No subsequent monuments found.)
 W. Pine 10 N70W 30 (" " " " accessories ")
 Cedar 12 S23E 31 (" " " " " ")

Corners 14 & 15: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner H5: Re-established 5/29/74 on line between Sec. Corners 40.040 ch. to E and to W.
 Corner 14: Established 5/30/74 on line between Sec. Cor. 20.137 ch. S and 1/4 cor. 20.137 ch. N.
 Corner 15: Established 5/29/74 on line between Sec. Cor. 20.020 ch. W and 1/4 cor. 20.020 ch. E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all three corners: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 Witnesses for Corner H5: Tamarack 8 B39½°W (mag.) 27.0 ft. "1/4S, NBT"
 B. Spruce 10 N16°W (mag.) 24.0 ft. "1/4S, NBT"
 Witnesses for Corner 14: Tamarack 4 N76°E (mag.) 62.3 ft. "1/16S, BT"
 Tamarack 4 S37°E (mag.) 88.1 ft. "1/16S, BT"
 Witnesses for Corner 15: Cedar 9 N 7°W (mag.) 9.6 ft. "1/16S, BT"
 Cedar 7 S60°E (mag.) 14.0 ft. "1/16S, BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE November 26, 1974

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
Arthur O. Enger
 Michigan Department of Natural Resources

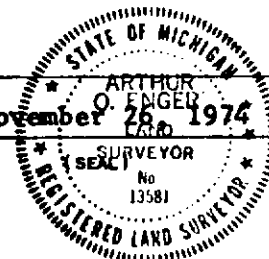

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581