

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> <del>XX</del> N. R. <u>31</u> <del>XX</del> W.	K4
2. PROPERTY CONTROLLING IN SECTION <u>12</u>	, T. <u>42</u> <del>XX</del> N. R. <u>31</u> <del>XX</del> W.	3 & 10
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**  
 Corner K4: Cedar post (Not found. App. Cor. wood post N23°W 7.8 ft.)  
           Hemlock 8 N74E 21 ( " " No subsequent accessories found.)  
           Cedar 6 S75W 15 ( " " " " " " )  
 Corners 3 & 10: Not established in original survey nor subsequently, apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**  
 Corner K4: Re-established 5/21/74 on line between Sec. Corners 40.102 ch. to N and to S. The found post was of some vintage, but there is no evidence to show it to be the original corner position.  
 Corner 3: Established 5/30/74 on line between Sec. Cor. 20.051 ch. N and 1/4 cor. 20.051 ch. S.  
 Corner 10: Established 5/21/74 on line between Sec. Cor. 20.051 ch. S and 1/4 cor. 20.051 ch. N.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**  
 Monuments for all three corners: 1" I.D. x 36" iron pipe with 3½" aluminum cap.  
 Witnesses for Corner K4: Tamarack 10 S32°E (mag.) 43.8 ft. "1/4S, NBT"  
                                   Tamarack 10 S31°W (mag.) 37.0 ft. "1/4S, NBT"  
 Witnesses for Corner 3: J. Pine 14 N68°E (mag.) 18.4 ft. "1/16S, BT"  
                                   J. Pine 10 S55°E (mag.) 10.5 ft. "1/16S, BT"  
 Witnesses for Corner 10: Red Maple 5 S46½°E (mag.) 14.9 ft. "1/16S, BT"  
                                   Red Maple 5 S57°W (mag.) 26.9 ft. "1/16S, BT"

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE November 26 1974  
CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger  
 Michigan Department of Natural Resources

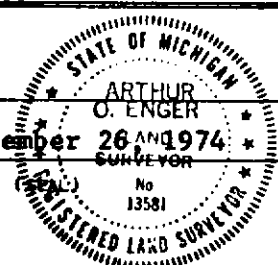

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581