

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} X _{S.} , R. <u>31</u> ^X _{W.}	K2 & L1
2. PROPERTY CONTROLL- 1 _____ ING IN SECTION _____	T. <u>42</u> ^{N.} X _{S.} , R. <u>31</u> ^X _{W.}	3
3. MISCELLANEOUS _____ PROPERTY IN SECTION _____	T. _____ ^{N.} _{S.} , R. _____ ^{E.} _{W.}	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner K2: Maple post (Not found. No subsequent monuments found.)
 Y. Pine 12 N52E 19 (" " " " accessories found.)
 W. Pine 16 S29W 14 (" " " " " ")
Corner L1: Hemlock post (Not found. Found R.R. iron in road.)
 W. Pine 14 N40E 28 (" " No subsequent accessories found.)
 W. Pine 14 N41W 26 (" " " " " ")
Corner 3: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner K2: Re-established 5/22/74 proportionately on line between Sec. Cor. 40.101 ch. S and Sec. Cor. 39.319 ch. N.
Corner L1: This is to report on the existing monument as found and not to affirm it as the original corner position or as properly re-established. Mon. is a length of narrow gauge railroad track set vertically in the approx. construction centerline of a N&S county road, buried in road bed. Presumably is the corner by common report, and is in line with old fence to E. Mon. bears N89°56'40"W 39.930 ch. from NE cor. Sec. 1 and S88°55'20"E 40.477 ch. from NW cor. Sec. 1.
Corner 3: Established 5/31/74 proportionately on line between 1/4 cor. 20.050 ch. S and Sec. Cor. 19.268 ch. N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for Corners K2 and 3: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
Witnesses for Corner K2: Red Pine 18 S20°W (mag.) 9.9 ft. "1/4S, NBT"
 Red Pine 7 N72°W (mag.) 11.8 ft. "1/4S, NBT"
Witnesses for Corner 3: Red Pine 10 S29°W (mag.) 12.6 ft. "1/16S, BT"
 Red Pine 8 S85°E (mag.) 6.6 ft. "1/16S, BT"
Corner L1: Witnessed monument as found.
 W. Spruce 9 S51 1/2°E (mag.) 43.2 ft. "NBT"
 W. Spruce 17 S24°W (mag.) 106.1 ft. "1/4S, NBT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE November 26, 1974
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

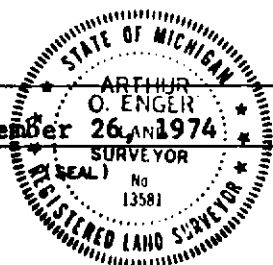

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581