

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> N. <u>31</u> XX R. <u>31</u> W.	G2 & H3
2. PROPERTY CONTROLLING IN SECTION <u>3</u>	, T. <u>42</u> N. <u>31</u> XX R. <u>31</u> W.	10 & 15
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19 , established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19 , found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner G2: Sugar post	(Not found. No subsequent monuments found.)
W. Pine 16 N47E 30	(" " " " accessories ")
Cedar 12 S28W 12	(" " " " " ")
Corner H3: Wood post	(Not found. No subsequent monuments found.)
Hemlock 8 N33W 28	(" " " " accessories ")
Spruce 10 S46E 30	(" " " " " ")

Corners 10 & 15: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner G2: Re-established 6/13/74 proportionately on line between Sec. Cor. 40.506 ch. S and Sec. Cor. 39.939 ch. N.

Corner H3: Re-established 6/12/74 on line between Sec. Corners 39.939 ch. to E and to W.

Corner 10: Established 6/17/74 on line between Sec. Cor. 20.253 ch. S and 1/4 cor. 20.253 ch. N.

Corner 15: Established 6/12/74 on line between Sec. Cor. 19.970 ch. W and 1/4 cor. 19.970 ch. E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all four corners: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.

Witnesses for Corner G2: W. Spruce 15 S17°W (mag.) 9.1 ft. "1/4S, NBT"
 W. Spruce 18 S68°E (mag.) 34.0 ft. "1/4S, NBT"

Witnesses for Corner H3: R. Pine 16 N69°W (mag.) 92.3 ft. "1/4S, NBT"
 R. Pine 21 S69°E (mag.) 85.6 ft. "1/4S, NBT"

Witnesses for Corner 10: J. Pine 6 N13°W (mag.) 21.3 ft. "1/16S, BT"
 B. Spruce 6 S86°E (mag.) 62.8 ft. "1/16S, BT"

Witnesses for Corner 15: R. Pine 6 N 6°E (mag.) 48.2 ft. "1/16S, BT"
 R. Pine 6 N73°W (mag.) 86.2 ft. "1/16S, BT"

(Distances horizontal)

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE November 26, 1974

CHIEF OF SURVEY PARTY
 Michigan Registered Land Surveyor
Arthur O. Enger
 Michigan Department of Natural Resources

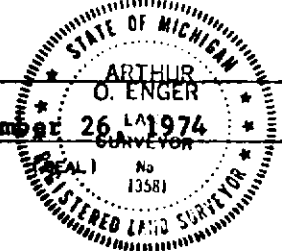

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581