


STATE OF MICHIGAN
DEPARTMENT
OF
NATURAL RESOURCES

LAND CORNER RECORD

Iron COUNTY
T 42N R 32W

DESCRIPTION OF CORNER Section Corner 22, 23, 26, and 27
CORNER MONUMENT 1" I. D. x 36" iron pipe with 4" aluminum cap
DATE MONUMENT PLACED AND WITNESSED June 9, 1971

WITNESSES TO CORNER..... Red Oak 14 N87°W (mag.) 65.0 ft. "S22, NBT"

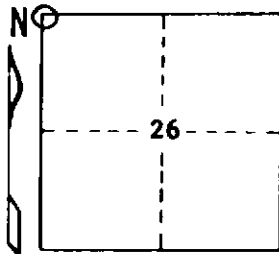

Red Oak 13 S15°W (mag.) 69.4 ft. "S27, NBT"

AND

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

Found an iron pipe S11°27'E 3.407 ch. set erroneously by some unknown person to represent this corner. Rejected the found iron pipe as being the true corner because of its gross misalignment with known corners in this township. It bears S87°24'40"W 79.48 ch. (record: West 80.00 ch.) from an original section corner to the east; S0°42'50"E 83.547 ch. (record: South 80.00 ch.) from an original section corner to the north; and corresponding differences from corners to south and west. Proportioned distances from known corners to E and W and from known corners to N and S arrive at points only 3 links apart, thus tend to support the corner set by the undersigned by double proportionate measurement. Found two red pine stumps to SE, one of which could have been an original BT, but no marks to identify it.

Variation 1°00' West at this corner.

SURVEYOR'S SEAL

DISTRIBUTION:

SIGNED

Arthur O. Enger
REGISTERED LAND SURVEYOR
Arthur O. Enger

DATE September 29, 1972

Forestry Division, Lansing

Area Forester

District Surveyor