

MAR 09 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Form with fields for County (Iron), Located In (T42N R35W), Corner Code # (J-5), and sections for Public Land Survey, Property Controlling, and Miscellaneous Property.

IRON COUNTY MICHIGAN RECEIVED FOR RECORD

99 DEC 30 AM 10:35
L.C. Records: L.8, P. 141
[Signature]

Register of Deeds Stamp & File Number

4. Lot No.
5. Private Claims

Quarter Corner to Sections 11 and 14, T42N, R35W

I, Gary L. Pisoni, in a field survey on Nov. 27, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Grid table with columns A-M and rows 1-13. A dot is marked at the intersection of row 5 and column J.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on August 13, 1851 by Harvey Mellen, U.S. Deputy Surveyor.
Original Corner; Wood Post
Original Bearing Trees:
Sugar 10" S 59° E 20 lks (13.20 feet)
Spruce 16" N 31° E 45 lks (29.70 feet)

PEER GROUP APPROVED
Iron County Rep 12-31-99
COUNTY REPRESENTATIVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.


At the corner position, set a railroad spike in the centerline of a county road running North and South, and in line with a fence line running East and West. I accept this procedure as the best available evidence for restoring the corner position.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set two (2) reference monuments being a 5/8" diameter by 30" long rebar pin with a 3" diameter aluminum cap stamped as follows:
Iron County Remonumentation, T42N, R35W, R.M., 1/4, S-11, S-14, S 43°W, 35.62 feet, 1999, RLS 27457;
T42N, R35W, R.M., 1/4, S-11, S-14, East, 19.77 feet, 1999, RLS 27457 from which I established the following new blazed and scribed bearing trees or reference objects:

Table listing reference monuments: R.M. 5/8" x 30" rebar N 43° E 35.62 feet, Utility Pole #74-2348 S 57° E 27.82 feet, R.M. 5/8" x 30" rebar West 19.77 feet, Popple 5" N 27° W 51.56 feet, Steel sign post West 20.27 feet.

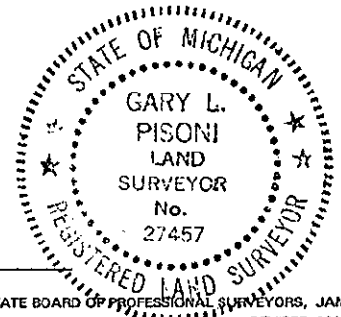

99-142
Signed by [Signature] Date 12-28-99
Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995