

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Iron	Located In:	Corner Code #
(County)		
<b>1. Public Land Survey</b>	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
<b>2. Property Controlling in Section</b>	S 19 T 43N R 31W	5
	S 19 T 43N R 31W	9
<b>3. Miscellaneous Property in Sec.</b>	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Jan 16 2002

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


**A. Description of original monument and accessories and/or subsequent restoration:**  
 (5-Sec. 19) North 1/16 corner, Section 19. Not established in the original survey.  
 (9-Sec. 19) East 1/16 corner, Section 19. Not established in the original survey.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(5-Sec. 19) Established the corner midway and on a straight line between Center of Section 1320.43' south and Quarter corner 1320.43' north.  
 (9-Sec. 19) Established the corner midway and on a straight line between Center of Section 1310.27' west and Quarter corner 1310.27' east.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(5) Set 1"IDx48" I. Pipe with 4" dia. alum. MDNR cap. Blazed and scribed: 7" Cedar N22E 17.3' "1/16S BT" 6" Cedar S85E 7.8' do 7" Cedar S25W 26.7' do 9" Cedar N58W 9.7' do	(9) Set 1"IDx32" I. Pipe with 4" dia. alum. MDNR cap. Blazed and scribed: .14" R.Pine N29E 44.1' "1/16S BT" 10" R.Pine S48E 18.4' do 8" R.Pine S19W 22.9' do 6" R.Pine S66W 32.5' do
Bearings are magnetic. Distances to notch in lower blaze. Placed sq'd cedar post adjacent.	Bearings are magnetic. Distances to notch in lower blaze. Set sq'd cedar post adjacent.

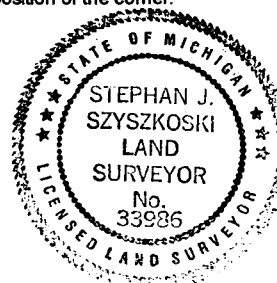

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 2/19/02

For the Michigan Department of Natural Resources - Office of Property Management