

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>W.</u> , R. <u>31</u> E.	D6
2. PROPERTY CONTROLLING IN SECTION <u>17</u>	T. <u>43</u> N. <u>W.</u> , R. <u>31</u> E.	8a & 11b
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found; recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 Corner D6: Not established in original survey nor subsequently, apparently.
 Corner 8a: Not established in original survey nor subsequently, apparently. This is an auxiliary meander corner on the west bank of Michigamme River on the true E & W 1/4 line.
 Corner 11b: Not established in original survey nor subsequently, apparently. This is an auxiliary meander corner on the east bank of Michigamme River between Government Lots 3 & 4.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 Corner D6: Established 5/10/74 at intersection of quarter lines. Monument set in mound of stones covered with dirt.
 Corner 8a: Established 5/9/74 on true E & W 1/4 line on W. bank of river, 23.538 ch. E'ly of 1/4 cor. bet. Sec. 17 & 18.
 Corner 11b: Established 5/9/74 on E. bank of river on true line bet. S 1/16 cor. bet. Sec. 17 & 18 and S 1/16 cor. on N & S 1/4 line, 17.712 ch. E'ly of first-mentioned corner and 22.327 ch. W'ly of last mentioned corner. Additionally, an aux. M.C. was established on the same line 3.483 ch. west on the W. bank of river, but not witnessed.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Corner D6: 1" I.D. x 40" iron pipe with 3 1/2" aluminum cap.
 Elm 7 N39°W (mag.) 12.9 ft. "1/4S, BT"
 Y. Birch 15 N69°E (mag.) 45.4 ft. "1/4S, BT"
 Monuments for 8a, 11a, & 11b: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Witnesses for Corner 8a: B. Ash 7 N47°W (mag.) 12.0 ft. "BT"
 B. Ash 7 S69°W (mag.) 27.0 ft. "BT"
 Witnesses for Corner 11b: B. Ash 6 S52°E (mag.) 10.7 ft. "AMC, BT"
 Elm 10 N38°E (mag.) 9.5 ft. "AMC, BT"
 Note: This monument is about 65 ft. E'ly of actually ordinary high water mark of river.

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
 APPROVED AND SIGNED BY Arthur O. Enger DATE April 1976
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR
 Michigan Department of Natural Resources

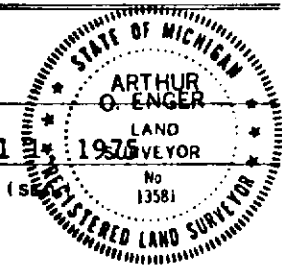

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581