

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>31</u> E. <u>W.</u>	D5
2. PROPERTY CONTROLLING IN SECTION _____	T. <u>43</u> N. <u>31</u> E. <u>W.</u>	1 & 5
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. <u>W.</u>	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner D5: B. Ash post	(Not found. No subsequent monuments found.)
Cedar 18 N34W 75	(" " " " accessories ")
Cedar 18 S31E 40	(" " " " " ")

Corners 1 & 5: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner D5: Re-established 4/25/74 on line between Sec. Cor. 39.930 ch. to E and to W. Corner falls at foot of a long, high hill from east, as per original field notes. See L. 1 of Survey Maps, P.10-20 for additional information.

Corner 1: Established 5/10/74 on line between Sec. Cor. 19.965 ch. W and 1/4 cor. 19.965 ch. E.

Corner 5: Established 5/10/74 on N & S $\frac{1}{4}$ line between N $\frac{1}{4}$ cor. 20.107 ch. N and Center $\frac{1}{4}$ cor. 20.107 ch. S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for all three corners: 1" I.D. x 36" iron pipe with 3 $\frac{1}{4}$ " aluminum cap.

Witnesses for Corner D5: Y. Birch 8 S70°W (mag.) 29.6 ft. "1/4S, NBT"
 Cedar 7 N83°E (mag.) 29.0 ft. "1/4S, NBT"
 Cedar 5 S42°E (mag.) 36.5 ft. "1/4S, NBT"

Witnesses for Corner 1: B. Ash 9 S 1°E (mag.) 33.2 ft. "1/16S, BT"
 B. Ash 11 N27°E (mag.) 14.1 ft. "1/16S, BT"

Witnesses for Corner 5: Cedar 5 S50°W (mag.) 21.6 ft. "1/16S, BT"
 Cedar 8 S38°E (mag.) 11.6 ft. "1/16S, BT"

Distances horizontal.

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE March 21, 1975

MICHIGAN REGISTERED LAND SURVEYOR
 Arthur O. Enger
 Michigan Department of Natural Resources

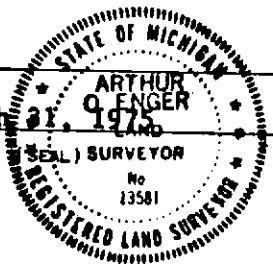

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581