

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>31</u> E. R. <u>31</u> W.	<u>G 5</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. <u>43</u> N. <u>31</u> E. R. <u>31</u> W.	<u>1</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corner G5:** Cedar post (Not found. No subsequent monuments found.)  
 Spruce 12 N28E 20 (" " " " accessories " )  
 Cedar 12 S34W 15 (" " " " " " )

**Corner 1:** Not established in original survey nor subsequently, apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

**Corner G5:** Re-established by proportionate measurement between corners 2 miles W and 1/2 mile E, and at record distance from a stream crossing 2.50 ch. S and a crossing of the same stream 1.20 ch. W. Position checks with another stream crossing 34.00 ch. N. For additional information, see L. 1 of Survey Maps, P.10-20.

**Corner 1:** Established on line between Sec. Cor. 20.000 ch. W and original 1/4 cor. 20.000 ch. E. Found a 2"x2"x30" squared pine slab N4°E 10.0 ft. for an approximate corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**Corner G5:** 5"x36" re-inforced concrete cylinder with 3 1/2" aluminum cap.  
 Cedar 10 S51°W (mag.) 49.2 ft. "S16, NBT"  
 Cedar 9 N38°W (mag.) 43.1 ft. "S 9, NBT"  
 Corner is in west ditch of county road.

**Corner 1:** 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.  
 White Spruce 14 S51°E (mag.) 40.9 ft. "1/16S, BT"  
 Elm 22 S10°W (mag.) 38.3 ft. "1/16S, BT"


SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

**FOR STATE AND UNITED STATES AGENCIES:**

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE March 31, 1975

  
 CHIEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR  
**Arthur O. Enger**  
 Michigan Department of Natural Resources

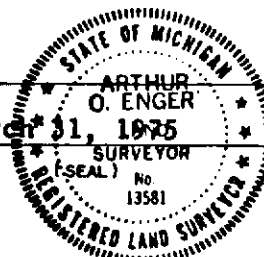

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581