

SURVEY & REMONUMENTATION

JAN 19 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #	
1. Public Land Survey	<u>T 43N R 33W</u>	<u>K-8</u>	
	T _____ R _____	_____	
	T _____ R _____	_____	
	T _____ R _____	_____	
2. Property Controlling in Section	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

98 DEC 28 AM 11:22
L. C. Record: L. 7, P. 301
Gilbert S. Sibley

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Quarter Corner Sections 23 and 24, T43N, R33W

I, Gary L. Pisoni, in a field survey on Nov. 25, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on September 17, 1851 by Guy H. Carleton, Deputy Surveyor.
 Original Corner; Wood Post
 Original Bearing Trees:

White Pine	14"	S 65° W	39 lks (25.74 feet)
Hemlock	12"	N 40° E	17 lks (11.22 feet)

In 1989, Gary L. Pisoni, RLS, restored the corner position on line and midway between the Northwest and the Southwest Section corners of Section 24. At the corner position, I set a railroad spike located in the East lane of Bristol Mine county road and in line with a fence line running East.. No bearing trees set.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found. Found railroad spike as described above and I accept the above railroad spike as the best available evidence for restoring the corner position.

Distance along the Section line is consistent with GLO distances.

Corner record research on file with County Representative.

PEER GROUP APPROVED

Iron A. Rose 12-18-98
 COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

From the above described corner position, I set two reference monuments being a 5/8" diameter by 30" long rebar, with a 3" aluminum cap stamped as follows: Iron County Remonumentation, T43N, R33W, R.M., 1/4, S-23, S-24, West, 32.98'; 1998, RLS 27457; T43N, R33W, R.M., 1/4, S-23, S-24, N 46° E, 44.19'; 1998, RLS 27457 from which I blazed and scribed the following new bearing trees: (All measurements taken to a nail in side of tree)

Utility Pole #85-26898		N 26°W	87.20 feet
R.M. 5/8" x 30" rebar		East	32.98 feet
R.M. 5/8" x 30" rebar		S 46°W	44.19 feet
Iron Pin 5/8" diameter		S 89°W	29.92 feet
Steel sign post		S 46°W	45.00 feet

98-149

Signed by


Gary L. Pisoni

Date

12-21-98

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

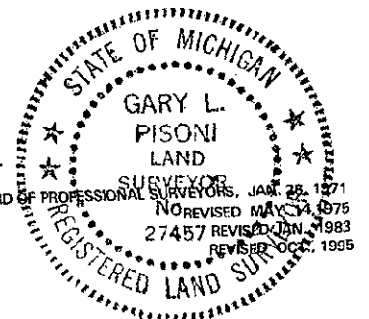

L. 7 P. 301