

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. 43 ^{N.} S. R. 33 ^{W.} E.	F5, G5, & G6
2. PROPERTY CONTROLLING IN SECTION_____	T. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:**
- Corner F5: Wood post (Not found. No subsequent monuments found.)
 - Tamarack 8 N24E 24 (" " " " accessories ")
 - Spruce 4 S72W 6 (" " " " " ")
 - Corner G5: Wood post (Not found. No subsequent monuments found.)
 - Y. Birch 14 N52W 52 (" " " " accessories ")
 - Lynn 10 S59E 14 (" " " " " ")
 - Corner G6: Wood post (Not found. No subsequent monuments found.)
 - Y. Birch 6 S77W 16 (" " " " accessories ")
 - Cedar 10 S72E 15 (" " " " " ")

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**
- Corner F5: Re-established 7/2/74 on line between Sec. Cor. 39.535 ch. to E and to W. Note: Monument angled, with punch mark over true point.
 - Corner G5: Re-established 7/1/74 on computed line between Sec. Cor. 80.465 ch. to N and to S, in accordance with method used to establish corner in original survey.
 - Corner G6: Re-established 7/1/74 on line between Sec. Cor. 40.233 ch. to N and to S.


- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**
- Monuments for all three corners: 1" I.D. x 36" iron pipe with 3½" aluminum cap.
 - Witnesses for Corner F5: W. Pine 18 N39°W (mag.) 30.2 ft. "1/4S, NBT"
R. Pine 20 S61°W (mag.) 11.7 ft. "1/4S, NBT"
 - Witnesses for Corner G5: Sugar Maple 5 S71°W (mag.) 8.7 ft. "S16, NBT"
Sugar Maple 9 S 9°E (mag.) 17.9 ft. "S15, NBT"
 - Witnesses for Corner G6: B. Ash 12 S82°W (mag.) 20.4 ft. "1/4S, NBT"
Elm 12 N19°E (mag.) 36.1 ft. "1/4S, NBT"

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
 APPROVED AND SIGNED BY Arthur O. Enger DATE October 22, 1975
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

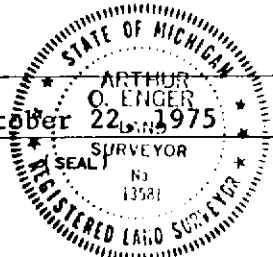

Arthur O. Enger
 Michigan Department of Natural Resources
 SURVEYOR'S MICHIGAN REGISTRATION NO. 13581