

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>33</u> E. <u>33</u> W.	A4 & A5
2. PROPERTY CONTROLLING IN SECTION _____	T. <u>43</u> N. <u>33</u> E. <u>33</u> W.	10
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner A4: Hemlock post (Not found. No subsequent monuments found.)
 Y. Birch 14 S71E 45 (" " " " accessories ")
 Lynn 10 N69W 13 (" " " " " ")

Corner A5: Cedar post (Probably found. Also found points of subsequent posts.)
 Spruce 12 S40E 68 (Not found. No subsequent accessories found.)
 Spruce 10 N30W 11 (" " " " " ")
 Fir 6 S43W 20 (" " " " " ")
 Cedar 8 N35E 26 (Found.)

Corner 10: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner A4: Re-established 11/8/72 on line between original sec. corners 40.101 ch. to N and to S. Corner is on stone ledge as reported in original survey notes.
Corner A5: Installed new monument on 7/23/73 at site of four old post points, found in swamp near an old cruisers' tree. One point is undoubtedly part of the original post. Found remains of cedar BT to NE in swamp peat, with axe marks on its pieces.
Corner 10. Established 11/8/72 on line between 1/4 cor. 20.050 ch. N and Sec. Cor. 20.050 ch. S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monuments for Corners A4 & A5: 1" I.D. x 36" iron pipe with 4" aluminum cap.
Witnesses for Corner A4: Sugar Maple 6 N1½°E (mag.) 13.9 ft. "1/4S, NBT"
 Sugar Maple 4 S63°W (mag.) 12.2 ft. "1/4S, NBT"
 (Var. 1°20' West) Sugar Maple 4 S25°E (mag.) 15.2 ft. "1/4S, NBT"
Witnesses for Corner A5: Balm-of-Gilead 5 S5½°W (mag.) 31.4 ft. "S13, NBT"
 W. Birch 6 S80°E (mag.) 13.6 ft. "S18, NBT"
 W. Birch 6 N46½° (mag.) 16.1 ft. "S12, NBT"
Corner 10: 1" I.D. x 30" iron pipe with 4" aluminum cap.
 (Var. 1°20' West) Cherry 4 S4°E (mag.) 23.4 ft. "1/16S, BT"
 Red Maple 4 N36°W (mag.) 68.9 ft. "1/16S, BT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 23, 1975
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

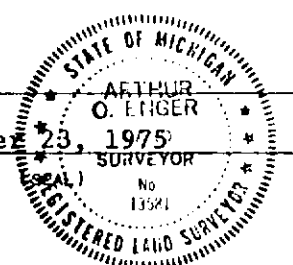

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581