

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> <sup>N.</sup> / <sub>S.</sub> R. <u>33</u> <sup>XX</sup> / <sub>W.</sub>	D3 & E3
2. PROPERTY CONTROLLING IN SECTION <u>8</u>	, T. <u>43</u> <sup>N.</sup> / <sub>S.</sub> R. <u>33</u> <sup>XX</sup> / <sub>W.</sub>	7
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ <sup>N.</sup> / <sub>S.</sub> R. _____ <sup>E.</sup> / <sub>W.</sub>	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

Corner D3: Wood post (Not found. No subsequent monuments found.)  
           Cedar 12 N34E 47 ( " " " " accessories " )  
           Cedar 10 S3°E 64 ( " " " " " " )  
 Corner E3: Wood post (Not found. No subsequent monuments found.)  
           W. Pine 12 N43E 34 ( " " " " accessories " )  
           W. Pine 16 S76W 52 ( " " " " " " )  
 Corner 7: Not established in original survey nor subsequently, apparently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

Corner D3: Re-established 6/27/74 on line between Sec. Cor. 39.969 ch. to E and to W. Corner falls on edge of swamp course SW, as per original notes.  
 Corner E3: Re-established 6/26/74 proportionately E & W between original corners 2 miles W and 1/2 mile E, and proportionately N & S between an original corner 1 mile N and the presumed 1/4 cor. location in Chicaugon Creek 1/2 mile S.  
 Corner 7: Established 6/26/74 on line between Sec. Cor. 20.114 ch. N and 1/4 cor. (in river) 20.113 ch. S.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Monuments for all three corners: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.  
 Witnesses for Corner D3: Cedar 5 N 7°E (mag.) 24.5 ft. "1/4S, NBT"  
                                   Cedar 6 S38°E (mag.) 58.4 ft. "1/4S, NBT"  
 Witnesses for Corner E3: White Pine 16 N46°E (mag.) 71.1 ft. "S4, NBT"  
                                   Sugar Maple 6 S79°W (mag.) 48.6 ft. "S8, NBT"  
 Witnesses for Corner 7: W. Spruce 6 S48°W (mag.) 60.0 ft. "1/16S, BT"  
                                   Balsam 5 N55°W (mag.) 13.8 ft. "1/16S, BT"

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE October 2, 1975  
CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger  
 Michigan Department of Natural Resources

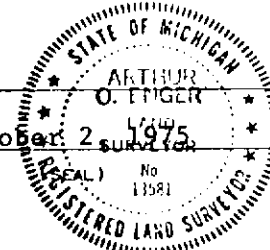

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581