

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. S. R. <u>33</u> E. W.	F1
2. PROPERTY CONTROLLING IN SECTION <u>4</u>	T. <u>43</u> N. S. R. <u>33</u> E. W.	1, 1a, & 1b
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19 , established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19 , found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner F1: Cedar post (Not found. No subsequent monuments found.)
 W. Pine 18 N30E 35 (" " " " accessories ")
 Y. Pine 20 N44W 52 (" " " " " ")

Corner 1: Not established in original survey nor subsequently, apparently.
 Corner 1a & 1b: Meander corners established and witnessed in original survey, but could find no evidence of posts or their accessories or of any replacement monuments or accessories.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner F1: Re-established 7/9/74 on line between original sec. corners 39.863 ch. to E and to W. Found a foresters' picket S33E 15.9 ft. for an approximate corner.

Corner 1: Established 7/9/74 on line between 1/4 cor. 19.931 ch. E and Sec. Cor. 19.932 ch. W.

Corner 1a: Re-established 7/11/74 on true sec. line on W bank of Paint River, 13.215 ch. E of Sec. Cor. and 26.648 ch. W of 1/4 cor.

Corner 1b: Re-established 7/9/74 on true sec. line on E bank of Paint River, 23.280 ch. W of 1/4 cor. and 16.583 ch. E of Sec. Cor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Monument for Corner F1: 1" I.D. x 36" iron pipe with 4" aluminum cap.
 Monuments for 1, 1a, 1b: 1" I.D. x 36" iron pipe with 3 1/2" aluminum cap.
 Witnesses for Corner F1: R. Pine 13 N74 1/2°W (mag.) 30.5 ft. "1/4S, NBT"
 R. Pine 11 S62°W (mag.) 30.1 ft. "1/4S, NBT"
 Witnesses for Corner 1: W. Spruce 12 S86°W (mag.) 37.0 ft. "1/16S, BT"
 W. Spruce 10 N36°E (mag.) 12.4 ft. "1/16S, BT"
 Witnesses for Corner 1a: Red Maple 7 N86°W (mag.) 28.2 ft. "M.C., NBT"
 B. Cherry 13 S38°W (mag.) 24.7 ft. "M.C., NBT"
 Witnesses for Corner 1b: B. Ash 4 S63°E (mag.) 45.8 ft. "M.C., NBT"
 Elm 8 N37°E (mag.) 19.2 ft. "M.C., NBT"

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 7, 1975
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

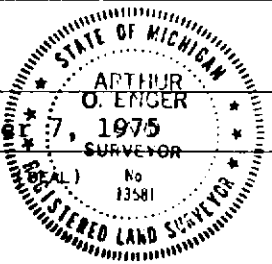

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581