

SURVEY & REMONUMENTATION

JAN 19 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>34W</u>	<u>M-8</u> ✓
	T <u>43N</u> R <u>33W</u>	<u>A-8</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

IRON COUNTY
MICHIGAN
RECEIVED FOR RECORD

98 DEC 28 AM 11:10

L.C. Record 1 L. 7, P. 235

Gary L. Pisoni

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Quarter Corner Section 24, T43N, R34W
Quarter Corner Section 19, T43N, R33W

I, Gary L. Pisoni, in a field survey on October 20, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on Sept. 10, 1846 by Austin Burt, U.S. Deputy Surveyor.

Original Corner; Sugar Post

Original Bearing Trees:

Sugar	7"	S 31° W	30 lks (19.80 feet)
Sugar	12"	N 63° E	28 lks (18.48 feet)

On 11-9-72, Arthur O. Enger, RLS with Michigan Dept. of Natural Resources restored the corner position by single proportionate measurement. He set a 4" diameter aluminum capped pipe monument 8" above the ground, stamped as follows: DNR, T43N, R34W, R33W, 1/4, S-24, S-19, 1972, RLS 13581 recorded in L.C. Certificate, Liber 1, Pages 293-294 on July 31, 1974.

1972 Bearing Trees:

Sugar Maple	7"	S 01° W	8.0 feet
Sugar Maple	7"	N 35° W	5.4 feet
Sugar Maple	6"	N 50° E	20.2 feet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found monument as set by Arthur O. Enger in 1972 and the following bearing trees:

Sugar Maple	9"	S 02° W	8.19 feet
Sugar Maple	8"	N 30° W	5.74 feet
Sugar Maple(dbl)	7"	N 53° E	20.44 feet

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Blazed and scribed the following new bearing tree: (All measurements taken to a nail in side of tree)

Sugar Maple	8"	S 68° W	29.56 feet
Steel sign post		East	1.54 feet

98-18

Signed by

Gary L. Pisoni


Date

12-21-98

Surveyor's Michigan License No.

27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JUN. 28, 1971

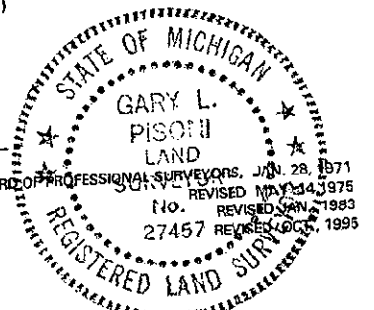

L. 7 P. 235