

SURVEY & REMONUMENTATION

JAN 19 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>35W</u>	<u>H-5</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

IRON COUNTY MICHIGAN
 RECEIVED FOR RECORD
 98 DEC 28 AM 11:29
L.C. Regorlo: L. 7, P. 334
[Signature]
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Quarter Corner Sections 10 and 15, T43N, R35W

I, Gary L. Pisoni, in a field survey on December 16, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5								●					
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established in August, 1851 by Harvey Mellen, Deputy Surveyor.

Original Corner; Wood Post

Original Bearing Trees:

Maple	6"	S 27° E	15 lks (9.90 feet)
White Pine	30"	N 32° E	21 lks (13.86 feet)

PEER GROUP APPROVED
Iron A. Pisoni 12-18-98
 COUNTY REPRESENTATIVE

In the early 1950's, W.E. Dewald, set a 7/8" diameter iron pin at the corner position.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Found the above described iron pin, 4" above ground surface, marking the quarter corner position.

I accept the iron pin as the best available evidence for restoring the corner position.

Distance along the Section line is consistent with GLO distance.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Over the top of the existing iron pin, set a 2" diameter by 30" long split base aluminum pipe monument with a 3" diameter aluminum cap stamped as follows: Iron County Remonumentation, T43N, R35W, 1/4, S-10, S-15, 1998, RLS 27457 from which I established the following new blazed and scribed bearing trees: (All measurements taken to a nail in side of tree)

White Pine	13"	N 45° E	20.02 feet
White Pine	10"	S 52° E	35.80 feet
Popple	12"	S 29° W	9.65 feet
White Pine	13"	N 44° W	39.08 feet
Steel sign post		S 15° W	0.65 feet

98-162
 Signed by Gary L. Pisoni Date 12-21-98

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JUNE 26, 1971
 REVISED MAY 24, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995

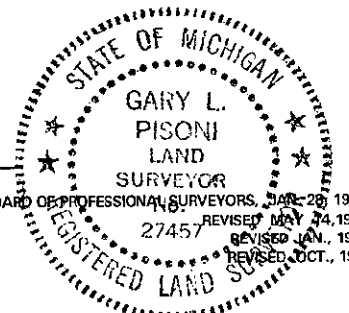

L. 7 P. 334