

STATE OF MICHIGAN  
DEPARTMENT  
OF  
NATURAL RESOURCES

LAND CORNER RECORD


Iron COUNTY  
T 44-45N R 31-32W

DESCRIPTION OF CORNER Section Corner 1, 6, 31, and 36 (also township corner)

CORNER MONUMENT 1" I.D. x 36" iron pipe with 4" aluminum cap

DATE MONUMENT PLACED AND WITNESSED October 23, 1968

WITNESSES TO CORNER..... Cedar 7 N7 $\frac{1}{2}$ °W 3 lks. "S36 NBT"

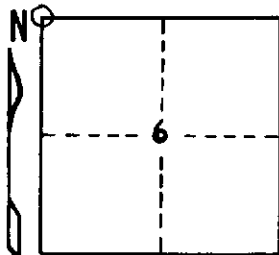

Cedar 5 N36 $\frac{1}{2}$ °E 32 lks. "S31 NBT"

Bl. Spruce 4 S14°W 14 lks. "S1 NBT"

AND

Balsam Fir 5 S26°E 22 lks. "S6 NBT"

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

Corner re-established by four-way proportionate measurement from an original section corner bearing N0°11'E 80.155 chains, a probable original section corner bearing N89°49'E 239.553 chains, a reputed original section corner bearing S0°06'W 78.629 chains, and a probable original section corner bearing N89°00'W 80.092 chains from the established point.

Found no evidence of the original post or its accessories or of any replacement monument or accessories or of any use of the general location. Corner lies in a heavily cutover, wet swamp with thick tag alder, balsam, cedar, and spruce.

SURVEYOR'S SEAL

SIGNED Arthur D. Enger DATE 3/24/69  
REGISTERED LAND SURVEYOR

DISTRIBUTION:

County Courthouse  
Area Forester (Regions I & II)  
District or Region Surveyor  
Forestry Div., Lansing

R 4047  
Rev. 10/68