

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Area

Located in:

Corner Code #

(Conts)

1. Public Land Survey

T 44N R 31W

K5

T R

T R

T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Jun 10 1997

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	16		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:  
(K5) Corner common to Sections 11-12-13-14. Corner established in 1849 by John Burt, D.S. "Set Sugar post corner of sections 11,12,13,14. N. Pine 26 S52E 53, do 30 N62W 51". found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K5) Original post not recovered. Monumented the corner in the original position as determined by the recovered remains of both W. Pine bearing trees found as follows: N. Pine 30 N62W 51 links, found a burned stump in very poor condition, no markings visible, at record bearing and distance, N. Pine 26 S52E 53 links, found ground level remains of W. Pine stump, of approximate record size, no markings visible, at record bearing and distance. Monumented original corners were recovered 2610.8' North (2640 R), and 5255.8' South (5280' R). From the corner monumented, original calls "west corrected 29.40 enter swamp" checks, "foot of hill 40 feet" 10 chains south checks, "foot of hill 40 feet SW" 20.18 chains east checks. An east-west blue line, painted by an unknown party, is south 52 feet. Also, a squared wood post, set by others, was found S52E approx. 102' from the corner. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MNRR tablet, appropriately stamped. The bearing tree remains were recovered during a diligent search. Approximately 8 hours was spent digging at this location. The two recovered 81 stumps were the only W. Pine stumps which remotely matched the record.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K5) Set 1" pipe with 4" MNRR cap.  
Blazed and scribed the following new bearing trees:

12" Spruce S16E 55.1' "S13 NBT"  
3" W. Pine S68W 13.1' "S14 NBT"  
6" Maple N15W 42.8' "S11 NBT"  
6" Sugar S61E 9.0' "S13 NBT"

South S2' E-W blue paint and cutting line. Bearings are magnetic. Distances are horizontal.

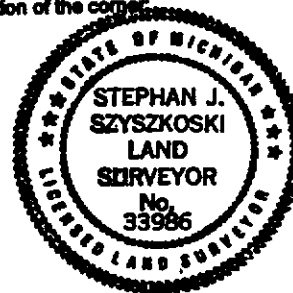

Signed by

Stephan J. Szyszkoski

Date

Sept. 8, 1997

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division