## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


For corners in Iron	Located in:	Corner Code #
(County)		
1. Public Land Survey	7 <u>44N</u> F 7 F 7 F	31W
Property Controlling in Section     Miscellaneous Property in Sec.	S TR S TR S TR S TR	

Register of Deeds Stamp & File Number

4. Lot No,	Recorded Plat	
5. Private Claims	· <del>-</del>	_

Sep 22 1997

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

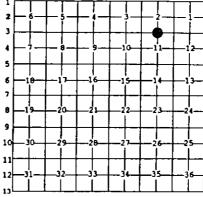

A. Description of original monument and accessories and/or subsequent restoration:
(J3) Quarter corner common to Sections 2-11. Corner established in 1849 by John Burt. "Set Y. Birch qr. Sec. Post. Tam 14 S19E 24, Tam 14 N22N 10". From the original record: Nest true line between 2 and 11 "...1) 19.00 Enter swamp, 2) 21.80 Brook 10 L C SN, ...40.01 Set qr. Sec. post...3) 40.50 Leave swamp C SN, 4) 45.00 Top of Ridge 20 feet C SN, ...5) 68.50 Leave swamp NaS, 6) 80.03 Section corner.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.
- (J3) Original post and accessories not recovered. Found no record of subsequent monumentation. Reestablished the corner according to the original record as referenced above: items 1)-5) check very well. The courses of these calls are all acute to the section line and would not fit along a line either to the north or south. The corner position as determined from these calls is quite definitive. Distances east and west to adjacent corners measures 2635.6' and 2636.3', respectively. This retraced line was extended westerly and I3 was reestablished on it's terminus. The terminus of the line is in proper proportion to recovered corners 1 aile north and 2.5 miles south of I3. At the position for J3, I placed a 1° I.O. x 32° iron pipe capped with a 4° dia. cast aluminum MONR tablet, appropriately stamped. 'From the corner monumented, I found a thin walled iron pipe, projecting approx. 4 ft. above ground S57N 35.9'. This pipe apparently represents an approximate position as it does not fit the original record. Corner placed and mitnessed by B.Wheeler and O.Lampela, Baraga District Office.

C Description of monument for corner and accessories established to perpetuate locating the position of the corner: (J3) Set 1 iron pips with 4 MDHR cap.

Blazed and scribed the following:

8" Spruce N12E 22.0" "1/45 NBT"

6" Spruce S37N 20.5' "1/45 NBT"

7" Spruce \$82M 9.6" "1/45 MBT"

7 Spruce \$82N 9.6" 1/45 NBT 8" Twin Spruce N47N 25.2"1/45 NBT"

Placed a squared spruce post adjacent.

Bearings are magnetic.

STEPHAN J. SZYSZKOSKI LAND SLIRVEYOR No. 33986

Signed by Surveyor's Michigan License No. 33986

11-18-97

For the Michigan Department of Matural Resources - Forest Management Division