

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Iron County

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 44 <sup>N.</sup> <del>S.</del> , R. 32 <sup>E.</sup> <del>W.</del>	E10, E13
2. PROPERTY CONTROLLING IN SECTION 29	T. 44 <sup>N.</sup> <del>S.</del> , R. 32 <sup>E.</sup> <del>W.</del>	<del>14</del>
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ <sup>N.</sup> <del>S.</del> , R. _____ <sup>E.</sup> <del>W.</del>	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-8, 1984, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Corner E10: Original monument and accessories not found.
- Corner 10: Not set on original survey nor subsequently apparently.
- Corner E13: Found two stumps matching species, bearing, and distance believed to be the original bearing trees. Also matched line tree stumps, one East and one North. Also position checks with stream calls North and East.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- Corner E10: Restored midway and on line between section corners North and South.
- Corner 10: Established midway and on line between  $\frac{1}{4}$  corner North and section corner South.
- Corner E13: Restored from stumps believed to be original BT's.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p><b>Corner E10:</b> Set 1" I.D. by 32" iron pipe with 4" alum. cap.          24" W. Pine S24W 24.9 ft. <math>\frac{1}{4}</math>S, NBT          20" W. Pine N68W 18.5 ft. <math>\frac{1}{4}</math>S, NBT</p> <p><b>Corner E13:</b> Set 1" I.D. by 32" iron pipe with 4" alum. cap.          11" Cedar S34E 15.2 ft. S4, NBT          12" Cedar N74E 25.0 ft. S33, NBT          8" Cedar N15W 40.7 ft S32, NBT</p>	<p><b>Corner 10:</b> Set 1" I.D. by 32" iron pipe with 4" alum. cap.          10" Cedar N20W 22.5 ft. 1/16S, BT          8" Cedar N65E 32.7 ft. 1/16S, BT          9" Maple S45E 16.9 ft. 1/16S, BT</p>
--	---

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Keith L. Sackett DATE 8-17-87

CHIEF OF SURVEY PARTY  
  
MICHIGAN REGISTERED LAND SURVEYOR  
**Keith L. Sackett**  
 Department of Natural Resources

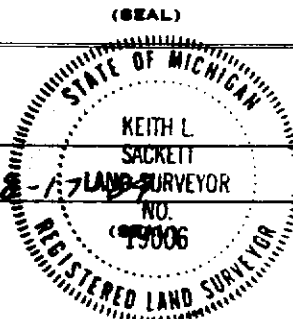

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006