

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(IRON COUNTY)

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. <u>33</u> E. <u>X</u> S. <u>X</u> R. _____ W.	<u>#B-7 &amp; C-6</u>
2. PROPERTY CONTROLLING IN SECTION <u>19</u>	T. <u>44</u> N. <u>33</u> E. <u>X</u> S. <u>X</u> R. _____ W.	<u>#2</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____ S. _____ R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corner B7 (1/4 corner between Sections 18 & 19, T44N, R33W):**
    - Wood post (Not found. Found 1" O.D. x 36" iron pipe in place.)
    - Y. Birch 18 S81E 27 (Not found. No subsequent accessories found.)
    - Hemlock 20 N81W 38 (Not found. No subsequent accessories found.)
  - Corner C6 (1/4 corner between Sections 17 & 18, T44N, R33W):**
    - Corner in county road, all original evidence long since obliterated.
  - Corner 2 (East 1/16 corner between Sections 18 & 19, T44N, R33W):**
    - Not established in original survey, and apparently incorrectly established later, as evidenced by an E & W and S fence intersection N45°W 29.0 ft.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


**Corner B7:** On 4-26-79, replaced found pipe with new monument. Pipe found at E & W and N fence intersection, origin unknown. Corner bears N88°38.6'E 38.390 ch. from corner on range line W and S89°49.3'W 40.354 ch. from mon. found at Sec. Cor. to E, which inconsistency is consistent with the probable original township subdivision as found by the undersigned's retracement of some 10.5 miles of section lines in this township. **Corner C6:** On 5-4-77, monumented as shown below, a point in the approx. CL of a N & S county road midway between old fences paralleling road on both sides and in projection of intersecting E & W fence lines crossing the road, said point presumed to be the corner by common report. **Corner 2:** Established 4-26-79 on line between Sec. Cor. 20.177 ch. E and 1/4 cor. 20.177 ch. W.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Corner B7:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
    - W. Spruce 20 N76°E (mag.) 98.9 ft. "1/4S, NBT"
    - Hemlock 24 S15°W (mag.) 52.3 ft. "1/4S, NBT"
    - Declination is 2°30' East.
  - Corner C6:** 8" galvanized gutter spike, buried in road-bed.
    - Power Pole S47°W (mag.) 32.10 ft. } To nail with ref. tag.
    - Fence Post S78°E (mag.) 22.23 ft. }
  - Corner 2:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
    - Sugar Maple 6 N63°E (mag.) 20.2 ft. "1/16S, BT"
    - Red Maple 4 S30°E (mag.) 16.8 ft. "1/16S, BT"
    - Declination is 3°10' East.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 Carl R. Johnson  
 SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY Carl R. Johnson DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY Arthur O. Enger DATE January 4, 1981  
MICHIGAN REGISTERED LAND SURVEYOR  
 Arthur O. Enger

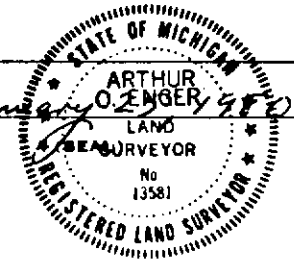

MICHIGAN Department of Natural Resources  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 13581