

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(IRON COUNTY)

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. S., R. <u>34</u> ²⁵ W.	M-12a & M12b
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 8, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Corner M12a (North Meander Corner between Secs. 31 & 36, T44N, R33-34W):**
 Wood post (Not found. No subsequent monuments found.)
 Spruce 14 S88W 32 (" " " " accessories ")
 Fir 10 N43E 31 (" " " " " ")
- Corner M12b (South Meander Corner between Secs. 31 & 36, T44N, R33-34W):**
 Wood post (Not found. No subsequent monuments found.)
 Cedar 16 S22W 35 (" " " " accessories ")
 Fir 7 S77½E 7 (" " " " " ")

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner M12a: Re-established on true sec. line on N bank of Paint River, 40.088 ch. N of Sec. Cor. 1, 6, 31, & 36 and 39.429 ch. S of Sec. Cor. 25, 30, 31, & 36. 1/4 corner bet. 31 & 36 is 21.72 ft. S of this corner, in river on line bet. this monument and another on S. bank. This monument could have been placed proportionately on line on the river bank, but was placed inland for protection.

Corner M12b: Re-established on true sec. line on S bank of Paint River 36.661 ch. N of Sec. Cor. 1, 6, 31, & 36 and 42.856 ch. S of Sec. Cor. 25, 30, 31, & 36. 1/4 corner bet. 31 & 36 is 204.46 ft. N of this corner, in river on line bet. this monument and another on N bank. Corner established proportionately to original record distance.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner M12a: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 B. Ash 9 N 3°E (mag.) 43.3 ft. "MC, NBT"
 Elm 12 N30°W (mag.) 36.1 ft. "MC, NBT"
 Declination is 0°45' East

Corner M12b: 1" I. D. x 36" iron pipe with 3 3/4" aluminum cap, set in mound of rocks.
 Cedar 20 N66°E (mag.) 53.1 ft. "MC, NBT"
 B. Ash 12 S69°W (mag.) 5.3 ft. "MC, NBT"
 Declination 0°15" East

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 25, 1977

Arthur O. Enger
 Michigan Department of Natural Resources

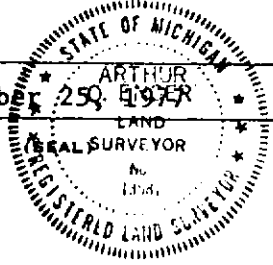

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581