

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

IRON COUNTY

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. _____ N. S., R. _____ E. W.	_____
2. PROPERTY CONTROLLING IN SECTION _____	T. <u>44</u> N. S., R. <u>34</u> E. W.	3a & 3b
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corner 3a (North Meander Corner between Sections 23 & 24, T44N, R34W):
    - Wood post (Not found. No subsequent monuments found.)
    - B. Ash 10 N10W 54 ( " " " " accessories " )
    - Maple 8 S58W 20 ( " " " " " " )
  - Corner 3b (South Meander Corner between Sections 23 & 24, T44N, R30W):
    - Wood post (Not found. No subsequent monuments found.)
    - Spruce 6 N69W 7 ( " " " " accessories " )
    - Cedar 8 S69E 9 ( " " " " " " )

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- Corner 3a: Re-established 7/14/77 on true sec. line on N bank of Paint River about 1 ch. upstream from head of Lower Hemlock Rapids. Corner is 12.172 ch. S of Sec. Cor. 13, 14, 23, & 24 and 27.800 ch. N of 1/4 cor. bet. 23 & 24. Corner shows substantial, but not exact, agreement with original meander notes of river.
  - Corner 3b: Re-established 8/4/77 on true sec. line on S bank of Paint River about 1 ch. upstream from head of Lower Hemlock Rapids. Corner is 14.880 ch. S of Sec. Cor. 13, 14, 23 & 24 and 25.092 ch. N of 1/4 cor. bet. 23 & 24.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Corner 3a: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
    - Silver Maple 12 S45°W (mag.) 21.4 ft. "MC, NBT"
    - Black Ash 6 N25°W (mag.) 44.4 ft. "MC, NBT"
 Declination is 1°15' East
  - Corner 3b: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap, set in mound of rocks.
    - Red Maple 6 S38°E (mag.) 21.7 ft. "MC, NBT"
    - Cedar 11 S51°W (mag.) 28.8 ft. "MC, NBT"
 Declination is 1°45' East

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE October 24, 1977

CHIEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger  
 Michigan Department of Natural Resources

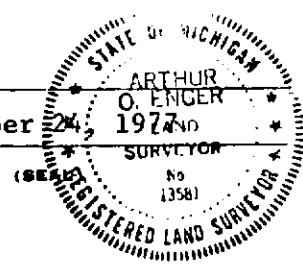

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581