

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. <u>34</u> W. R. _____	B7 & C7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ E. S. _____ R. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. S. _____ R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan, P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 29, 1976, established re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corner B7 (1/4 corner between Sections 18 & 19, T44N, R34W):
    - Wood Post (Not found. No subsequent monuments found.)
    - Fir 6 S51E 11 ( " " " " accessories " )
    - Fir 4 N26 1/2 W10 ( " " " " " " )
  - Corner C7 (Section Corner 17, 18, 19, & 20, T44N, R34W):
    - Wood Post (Not found. Found NPM iron pipe in place.)
    - Y. Birch 30 S68E 32 ( " " Found Elm 14 N78W 48 lks.)
    - Y. Birch 26 N26W 52 ( " " No other accessories found.)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner B7: Re-established proportionately on line between original Sec. Cor. S89°14.5'W 39.664 ch. and original Sec. Cor. N89°14.5'E 40.116 ch.

Corner C7: Re-witnessed NPM monument, which was set on 12/9/53 at site of an L.E.S. post, which NPM records dated May 1931 say was set from the original BT to SE, still visible at that time. No original evidence visible now. As found on this date, the NPM NBT is an Elm 16 N81°W (mag.) 31.2 ft. (47.3 lks.), with blazes completely grown over.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner B7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
3"x3"x5' squared & scribed cedar guard post set alongside of monument.  
No witnesses available - corner in tag alder marsh.

Corner C7: 1" I.D. x 36" (presumed) iron pipe with 2" brass cap (NPM)  
Sugar Maple 8 N11°W (mag.) 17.8 ft. "S18, NBT"  
Sugar Maple 10 S73°E (mag.) 48.6 ft. "S20, NBT"

Note: Monument leans to NW. Distances are to center of brass cap as found.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE January 26, 1977

CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger  
Michigan Department of Natural Resources

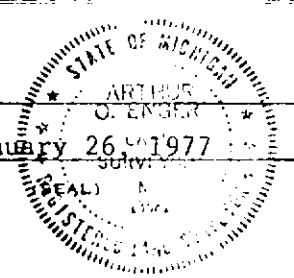

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581