

**SURVEY &
REMONUMENTATION**

FEB 21 2001

SECTION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

COMMENCING YEAR 2000
RECEIVED FOR RECORD
IRON COUNTY, MICHIGAN

00 DEC -5 PM 12: 51
L.P. Recygar, L. S., P. 227
Richard L. ...
REGISTER OF DEEDS

For corners in

<u>Iron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>36W</u>	<u>H-1</u>
	T <u>44N</u> R <u>36W</u>	<u>H-13</u> ✓
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Robert A. Goodreau in a field survey on May 10, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

H-1/H-13 Original corner established by Austin Burt, U.S. Deputy Surveyor, in 1847.

Original witnesses: Sugar Maple 16" N 47° E 16 links
Elm 20" N 65° W 28 links

Donald D. Lappala RLS restored corner position on 23 September 1964 w/ a cross (x) in pavement, using 1934 Michigan State Highway plans and a reference monument. He also set a 2" x 5' concrete filled ref. mon. w/ bronze tablet (Liber 3, Page 290).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-1/H-13 Found PK nail in pavement as described by Gary Pisoni RLS.

Found reference monument set by Lappala described as: North 69.8'

Corner record research on file with county representative.

PEER GROUP APPROVED


Ken Ray, L. P. 11-14-2000
COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-1/H-13 Accepted corner as found.

Witnesses: 7' Balsam Fir S 26° E 128.49'
8' Spruce N 56° W 89.07'
5' Balsam Fir N 41° E 69.0'
Mon. box West 10.49'
Sign Post 1' North of Reference Monument

Note: Measurements taken to a nail in side of witnesses.

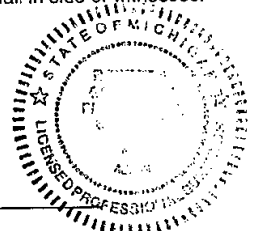

Signed by *R.A. Goodreau*
Surveyor's Michigan License No. 43053

Date July 1, 2000