

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S <u>23</u> T <u>45N</u> R <u>31W</u>	<u>11</u>
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims		

Register of Deeds Stamp & File
Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Apr 13 2006

I, Stephan J. Szyszkoski, in a field survey on _____, 20__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(11-Sec. 23) Southwest 1/16 corner, Section 23. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(11-Sec. 23) Established the corner at the intersection of straight lines connecting opposite 1/16 corners. The position thus established falls in the Fence River and was not monumented. Established two Witness monuments, one 147.33' north of the corner position and on the N-S 1/16 line, and the other 130.00' west of the corner position and on the E-W 1/16 line.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(11) Set 1"IDx32" I.pipe with 4" alum. MDNR cap, a WITNESS MONUMENT on the N-S 1/16 line 147.33' north of the corner. 8" dbl B.Ash S74E 15.1' mrkd "WC BT" N76W 25.45' SW cor. E'ly abutment S47W 196.87' DNR mon. to west of #11 S85W 160.31' DNR mon. south of road 110' W. of C/L river.

Set sq'd cedar post adjacent. Bearings are magnetic. Dist. to tree is to nail with tag.

(11) Set 1"IDx32" I.pipe with 4" alum. MDNR cap, a WITNESS MONUMENT on the E-W 1/16 line, 130.00 feet west of the corner position. N12W 123.00' DNR mon. South of road 110' W. of C/L river stamped "GPS PT ERIC" N47E 196.87' DNR mon. WC north of 1/16 corner #11 10" Maple S86W 58.96 mrkd "WC BT"

Set sq'd cedar post adjacent. Bearings are magnetic. Dist. to tree is to nail with tag.

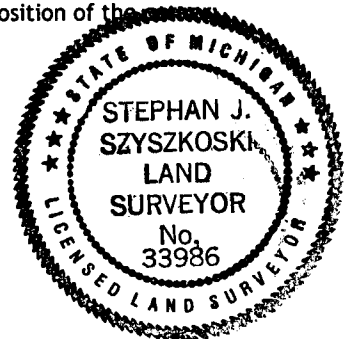

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/1/06

For the Michigan Department of Natural Resources, Office of Land and Facilities