

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

IRON COUNTY

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 45 N. R. 32 W. ^{XX}	E5, C7, C8
2. PROPERTY CONTROLLING IN SECTION	17 T. 45 N. R. 32 W. ^{XX}	1
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corner E5: Original monument and accessories not found.
 - Corner C7: Original monument and accessories not found. Found old square post.
 - Corner 1: Not set on original survey nor subsequently apparently.
 - Corner C8: Original monument and accessories not found.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- Corner E5: Restored 5-3-83 by double proportion distance.
 - Corner C7: Restored 5-3-83 at old square post. Fits good with land calls and other corners in area
 - Corner 1: Established 1-7-83 midway and on line between corners east and west.
 - Corner C8: Restored 5-3-83 midway and on line between corners north and south.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- | | |
|---|--|
| <u>Corner E5</u> : Set 1" I.D. by 32" I.P. w/4" alum. cap.
4" Spruce N21E 19.2 ft S9, NBT
14" Spruce N62W 48.3 ft S8, NBT
<u>Corner C7</u> : Set 1" I.D. by 32" I.P. w/4" alum. cap.
8" Spruce N20W 21.6 ft S18, NBT
6" Balsam N86W 9.9 ft S18, NBT
6" Spruce S71E 31.6 ft S20, NBT | <u>Corner 1</u> : Set 1" I.P. by 32" I.P. w/4" alum. cap.
7" Cedar S88E 3.1 ft 1/16S, BT
5" Cedar N45W 9.4 ft 1/16S, BT
12" Cedar S89W 15.7 ft 1/16S, BT
<u>Corner C8</u> : Set 1" I.D. by 36" I.P. w/4" alum. cap
9" Spruce S13W 109.6 ft 1/4S, NBT
1 1/2" I.D. by unknown length iron pipe S87E
97.44 ft. Corner falls in open marsh. |
|---|--|

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Keith L. Sackett DATE 6 29 83
CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

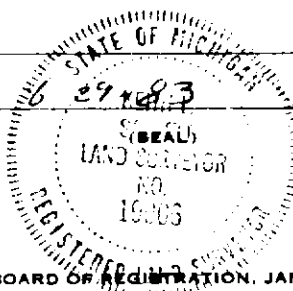

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET