

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

IRON COUNTY

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. .... N. S. R. .... E. W. ....	-----
2. PROPERTY CONTROLLING IN SECTION 31.....	T. 45 N. XX R. 32 W. XX	2,7,14, MC between
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. .... N. S. R. .... E. W. ....	14 & C12
4. LOT NO. ...., RECORDED PLAT.....	-----	-----
5. PRIVATE CLAIMS.....	-----	-----

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-2-83, 19  , established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on                     , 19  , found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and or subsequent restoration:
- Corner 7: Not set on original survey. Found old bed iron N51W, 27.5 ft.
  - Corner 14: Not set on original survey nor subsequently apparently.
  - Meander corner: Original monument and accessories not found.
  - Corner 2: Not set on original survey nor subsequently apparently.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- Corner 7: Established midway and on line between corners north and south.
  - Corner 14: Established midway and on line between corners north and south.
  - Meander corner: Set on line on south shore of small lake in sections 31 and 32.
  - Corner 2: Established midway and on line between corners east and west.


- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- |   |  |
|---|--|
| Corner 7: Set 1" I.D. by 32" I.P. w/4" alum. cap.<br>14" Spruce S30W 43.7 ft 1/16S, BT<br>5" Spruce S52E 53.4 ft. 1/16S, BT<br>14" Spruce N62E 42.7 ft. 1/16S, BT                                 | Meander corner: Set 1" I.D. by 32" I.P. w/4" alum. cap.<br>8" Cedar N60E 9.3 ft. MC, BT<br>4" Tam N12W 8.1 ft. MC, BT.<br>5" Spruce S08W 20.1 ft. MC, BT             |
| Corner 14: Set 1" I.D. by 32" I.P. w/4" alum. cap.<br>10" Maple N46E 15.4 ft 1/16S, BT<br>7" Maple S50E 17.5 ft 1/16S, BT<br>6" Maple S70W 19.3 ft 1/16S, BT<br>7" W. Birch squared south 2.0 ft. | Corner 2: Set 1" I.D. by 32" I.P. w/4" alum. cap.<br>8" Spruce N70E 32.0 ft. 1/16S, BT<br>10" Spruce S29E, 40.7 ft. 1/16 S, BT<br>6" Spruce N08W, 37.6 ft. 1/16S, BT |
- SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (BEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Keith L. Sackett DATE 5-29-83  
MICHIGAN REGISTERED LAND SURVEYOR

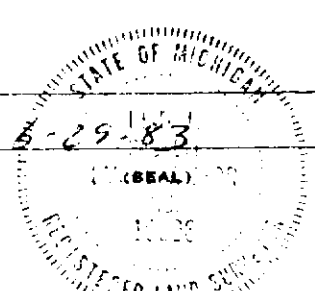

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET