

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF-- | LOCATED IN-- | CORNER CODE NUMBER |
|--|---|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. <u>45</u> ^{N.} XX , R. <u>34</u> ^{XX} W. | C11 |
| 2. PROPERTY CONTROLLING IN SECTION <u>32</u> | T. <u>45</u> ^{N.} XX , R. <u>34</u> ^{XX} W. | 1 & 1a |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ ^{N.} S., R. _____ ^{E.} W. | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

| | |
|-----------------------|---|
| Corner C11: Wood post | (Not found. Found NPM approx. corner picket.) |
| Y. Birch 20 N54W 26 | (" " No subsequent accessories found.) |
| Aspen 10 S81E 33 | (" " " " " ") |
| Corner 1a: Wood post | (Not found. No subsequent monuments found.) |
| W. Birch 12 S68W 16 | (" " " " accessories ") |
| W. Birch 6 N78W 46 | (" " " " " ") |

Corner 1: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner C11: Re-established 9/1/72 by proportion between Sec. Cor. 160.056 ch. N and 80.029 ch. S and at record distance of 79.90 ch. E of the Sec. Cor. on the W township boundary, as this procedure seems to best conform with the original record distance between the latter corner and the Net River to E. Northern Paper Mills corner picket is S51°E 10.7 ft.

Corner 1a: Re-established 9/3/74 on true section line on E. bank of Net River, 15.620 ch. W. of 1/4 cor. and 23.300 ch. E of Sec. Cor.

Corner 1: Established 8/23/74 on line between Sec. Cor. 19.970 ch. W and 1/4 cor. 19.970 ch. E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

| | |
|---|--|
| Corner C11: 1" I.D. x 36" iron pipe with 4" aluminum cap. | |
| Red Maple 18 S10°E (mag.) 31.6 ft. "S32, NBT" | |
| Red Maple 17 N85°W (mag.) 7.3 ft. "S30, NBT" | |
| Red Maple 12 N88°E (mag.) 14.2 ft. "S29, NBT" | |
| Corner 1a: 1" I.D. x 36" iron pipe with 3½" aluminum cap. | |
| Twin B. Ash 15 S83°E (mag.) 9.7 ft. "M.C. NBT" | |
| B. Ash 10 N45°E (mag.) 64.5 ft. "M.C. NBT" | |
| Corner 1: 1" I.D. x 36" iron pipe with 3½" aluminum cap. | |
| W. Spruce 16 S71°E (mag.) 31.5 ft. "1/16S, BT" | |
| W. Spruce 14 S65°W (mag.) 23.6 ft. "1/16S, BT" | |

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE _____

CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
Michigan Department of Natural Resources

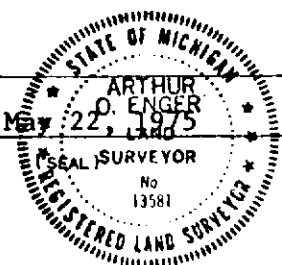

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581