

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>45</u> N. <u>X</u> , R. <u>34</u> <u>X</u> W.	A12; A13; & B13
2. PROPERTY CONTROLLING IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on see below 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corner A12:** Sugar Maple post (Not found. Found L.E.S. post N45°W 13 lks.)  
 Cedar 14 S73E 10 {Not found. No subsequent accessories found.  
 Sugar 6 N31W 16

**Corner A13:** Cedar post (Not found. Found L.E.S. post S16°E 15.4 lks.)  
 Y. Birch 20 N15W 24 (Not found)  
 W. Pine 34 S62E 42 (Probably found)

**Corner B13:** Fir post (Not found. No subsequent monuments found)  
 Y. Birch 12 N31E 18 {Not found. No subsequent accessories found)  
 Sugar 7 N48W 24

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

**Corner A12:** Re-established 8/17/72 on line between twp. corner 39.974 ch. S and original section corner 279.818 ch. N.

**Corner A13:** Corner re-established 5/11/71 from remains of a white pine stump corresponding to the described original. Probability of stump being the BT determined by measuring direction and distance from original corners to N and E, finding these to check closely with the original record.

**Corner B13:** Re-established 8/17/72 on line between twp. corner 39.025 ch. W and original section corner 200.131 ch. E.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**Monuments for all three corners:** 1" I.D. x 36" iron pipe with 4" aluminum cap.

**Witnesses for Corner A12:** Red Maple 5 N38°E (mag.) 20.9 ft. "1/4S, NBT"  
 (Variation 1°00' West) W. Spruce 14 S25°W (mag.) 3.4 ft. "1/4S, NBT"

**Witnesses for Corner A13:** Red Maple 7 S44°E (mag.) 25.4 ft. "S 6, NBT"  
 Red Maple 6 N67°E (mag.) 16.3 ft. "S31, NBT"  
 Sugar Maple 6 N70°W (mag.) 9.2 ft. "S36, NBT"

**Witnesses for Corner B13:** W. Spruce 11 S 1°E (mag.) 15.2 ft. "1/4S, NBT"  
 Balsam 9 N68°E (mag.) 37.7 ft. "1/4S, NBT"

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Arthur O. Enger DATE December 28, 1973

MICHIGAN REGISTERED LAND SURVEYOR  
**Arthur O. Enger**  
 Michigan Department of Natural Resources

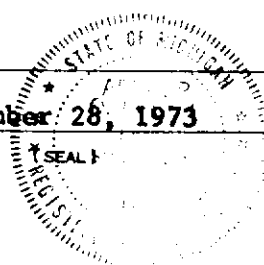

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581