

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

(IRON COUNTY)

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 46 <sup>N.</sup> <del>X</del> X, R. 33 <sup>XX</sup> W.	C-10
2. PROPERTY CONTROLLING IN SECTION	30, T. 46 <sup>N.</sup> <del>X</del> X, R. 33 <sup>XX</sup> W.	7 & 14
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____, <sup>N.</sup> _____, <sup>E.</sup> _____, <sup>S.</sup> _____, <sup>W.</sup> _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on September 21, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**Corner C10 (1/4 corner between Sections 29 & 30, T46N, R33W):**  
 Wood post (Not found. See B for subsequent monuments.)  
 Hemlock 10 S51E 29 ( " " No subsequent accessories found.)  
 Maple 10 N83W 4 ( " " " " " " )

**Corner 7 (North 1/16 corner between Sections 29 & 30, T46N, R33W) and  
 Corner 14 (S 1/16 corner between Sections 29 & 30, T46N, R33W):**  
 Neither of these corners established in original survey and by approximation only, subsequently.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

**Corner C10:** Restored on line between original sec. corners N0°02'W 2638.34 ft. and S0°02'E 2638.34 ft. Found a 2"x2"x5' squared cedar picket post S76°W 12.8 ft. and another 2"x2"x5' squared maple picket post N40°W 7.2 ft. for foresters' approximate corners.

**Corner 7:** Established on line between Sec. Cor. N0°02'W 1319.17 ft. and 1/4 cor. S0°02'E 1319.17 ft. Found a 2"x2"x4' squared picket post N29°E 13.1 ft. for an approximate corner.

**Corner 14:** Established on line between Sec. Cor. S0°02'E 1319.17 ft. and 1/4 cor. N0°02'W 1319.17 ft. This point falls on the east root of a 24" sugar maple, consequently a monument was placed 3.0 ft. due East of it for a witness corner. Found a 2"x2"x4' squared picket post N50°W 14.1 ft. for an approximate corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**Corner C10:** 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.  
 Red Maple 10 S46°E (mag.) 18.7 ft. "1/4S, NBT"  
 Y. Birch 13 N84°W (mag.) 25.0 ft. "1/4S, NBT"  
 Declination 3°00' West

**Corner 7:** 1" I.D. x 36" iron pipe with 2" brass cap (NPM)  
 Sugar Maple 10 S81°E (mag.) 18.8 ft. "1/16S, BT"  
 Hemlock 14 N71°W (mag.) 15.7 ft. "1/16S, BT"  
 Declination 3°25' West.

**Corner 14:** 1" I.D. x 36" iron pipe with 2" brass cap (NPM) for witness corner  
 Sugar Maple 14 S7°W (mag.) 15.6 ft. "1/16S, BT"  
 Sugar Maple 13 N88°E (mag.) 24.7 ft. "1/16S, BT"

Note: BT's are for the iron pipe, not the true corner. Declination 3°40' West.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE May 5, 1978

CHIEF OF SURVEY PARTY  
*Arthur O. Enger*  
 MICHIGAN REGISTERED LAND SURVEYOR  
 Arthur O. Enger

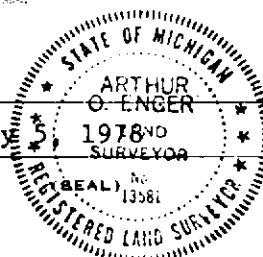

Michigan Department of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581