LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


F٥	DF I	CO	m	ar	a ì	n

Iron	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>46H_R</u> R R R	<u> </u>
Property Controlling In Section Miscellaneous Property in Sec.	S_22 T46N R S T R S T R S T R	34N 10

Register of Deeds Stamp & File Number

> 10 Jul 27 1998 G11 Jul 21 1998

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

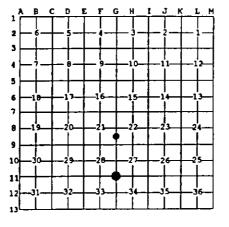

A. Description of original monument and accessories and/or subsequent restoration:

(G11) Corner common to Sections 27-28-33-34. Corner established in 1852 by Zelotes B. Searles: "H8'W Corrected...79.90 Set post Cor. of Secs. 27,28,33 & 34. Heml 12 S60E 14, Y. Birch 22 H22W 30." Found no subsequent record.

(10-Sec. 22) South 1/16 corner between Sections 21-22. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(GII) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Restablished the corner by double proportionate measurement to the original record between original corners 39.8467 ch. west (39.815R), 79.8905 ch. north (79.90R), 40.0876 ch. east (40.06R), and a corner restored from local evidence 79.8905 ch. south (79.90R). At the position for the corner I placed a l'IDx32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and mitnessed by O.Lampela and B.Wheeler, Baraga District Office.

(10-Sec. 22) Found no evidence of prior monumentation at the corner postion. Established the corner midway and on a line of mean true bearing between Section corner 20.0447 ch. South and Quarter corner 20.0447 ch. Morth. At the position for the corner I placed a 1° I.D. x 32° iron pipe capped with a 4° dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office. I found a 5/8° dia. rebar 6' long, driven to project 48°, 569E 5.1' from the corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the con

are magnetic.

(G11) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:
7" Y. Birch S55M 5.4" "S33 MBT"
16" Y. Birch M21W 46.95" "S28 MBT"
6" Y. Birch M27E 27.9" "S27 MBT"
16" Hemlock S80E 40.65" "S34 MBT"
Placed a squared sugar post adjacent.
Distances are to meas, notch. Bearings are magnetic.

(10) Set 1" pipe with 4" MOHR cap.
Blazed and scribed the following:
12" Cedar SBIE 10.6' "1/16S BT"
7" Y. Birch SION 25.4' do
7" Y. Birch S57N 25.1' do
15" Hemlock MILE 46.5' do
Placed a squared cedar post adjacent.
Distances are to meas, notch. Bearings

STEPHAN J.
SZYSZKOSKI
LAND
SURVEYOR
No.
33986

Signed by Stephen J. Syngholish
Surveyor's Michigan License No. 33986

Date 12/29/98

For the Michigan Department of Natural Resources - Forest Management Division